10/30/25		,				
Registration N8794P	Make Piper	Model 1965 PA24B Comanche				
Serial No.	Engine	Paint	Interior Airtex Cream textile seats with cream/tan side panels and	Tach / AFTT MGTOW	Empty Weight Useful Load CG	
24-4247	IO-540-D4A5	White w/Brown, Orange and Red (original)	brown carpet (2001)	3100	1882.96 1217.04	82.96
Log Airframe Log 1	November-7 March-7 September-7	tem(s) Addressed 5 STANDARD airworthiness certificate issued 2 CW AD 72-22-5 by installing Piper kit 760 705 3 Installed Hoskins strobe 3 Installed Leigh Sharc-7 Type ELT 4 CW AD 74-18-15 Shark 7 ELT by installing suppressor part CW AD 77-08-01 by installing Piper kit 760 914 aileron OB hinge bracket. CW AD 77-13-21 and SL 782A Landing Gear	Critical Item Maintained in Allentown, PA Maintained in Oklahoma	0 1950 2052 2148 2306		
Airframe Log 2	December-7 September-8 January-8	Inlige Bracket. CW AD 77-13-21 and St 782A Landing Geaf 7 Extension System 9 Replaced ELT with Narco ELT 10 0 CW AD 79-20-10 by installing kit 763 893 1 RH main tank repaired and reinstalled. 1 Installed metal-to-metal seatbelts for pilot and copilot Installed AD-8 marker beacon, ANT 650A ADF, Ki209 VOR, KX170B Nav/Com, KMA24 audio panel, KN75, Narco VOR/LOC		2489 2674 2700 2729 2831		
	July-8 October-8	2 glideslope indicator in place of previous 2 Removed RH aux tank and reinstalled, leak check OK Replaced all 6 cabin side windows with LP Aero Plastics with 5 1/4" clear windows 6 Installed new 1/4" windshield IAW STC SA3070WE Installed new alternator drive belt and replaced broken	Avionics upgrade	2875 2901 3320 3437		
		0 nutplate on spinner bulkhead CW AD 91-21-09 by installing STC SA2694CE by Webco,		3790		
		3 inducted alternate heat system. See 337 6 Installed new aux fuel pump	Maintained in CO	4009 4208		
	November-9	Installed LH wing main and aux fuel bladder tanks with new 8 hoses and hardware as needed Installed new RH wing main and aux fuel cells. Both main and	Maintained at Poplar Grove in IL	4318		
	September-9	aux fuel senders were OH'd. Replaced horizontal stabilizer RH 9 OB leading edge skin. Painted and checked balance CW AD 77-13-21 Part A. Engine reinstalled with new shock		4410		
Airframe Log 3	April-0	mounts and all new flex hoses. Installed GX60, SL15M, SL30, MX20, and associated antennae.		4405		
	June-0	0 See 337 Installed Precise Flight Standby vacuum system IAW STC SE1780NM, El VA-1A volt/ammeter STC SA2693NM, JPI EGT/CHT engine scanner with fuel flow STC SA2586NM, Whelen A650 wing strobes STC SA800EA, LoPresti hub caps STC SA01224AT, MetCoAir wing tips STC SA871WE, Ron Jon's Instrument panel STC SA00159SE, K2U wing root fairings STC SA526GL. See 337. Installed new HC-G3Yr-IRF prop. Installed	Avionics upgrade	4408		
		0 new Brackett air filter STC SA693CE 0 Installed engine oil separator M-20. See 337 Installed Leonard Spall front seat belt/shoulder harness STC SA00484WI. Installed GLAP cabin side windows, pilots and cabin door windows IAW STC SA271GL. Installed Webco upper door latch kit IAW STC SA2549CE. Installed K2U baggage door air strut IAW STC SA307CH. Installed new Airtex headliner, carpet, seats and sidewall upholstery. Installed new fiberglass	Avionics upgrade	4408 4429		
		1 instrument panel and glareshield Installed the following: Airwolf air-oil separator IAW STC SA02268CH, Challenger Air filter IAW STC SA01669CH, K2U HID Light in RH wing tip IAW STC SA01834CH, K2U Gear Lobe Fairings IAW STC SA1711GL, K2U Aileron Gap Seals IAW STC		4437		
	June-0	7 SA526GL. Installed Dukes fuel boost pump Installed K2U HID light IAW STC SA01834CH in LH wing tip, and 7 Bogert Electrical Cables IAW STC SA3531MM. 7 Installed Horizon Digital Tach IAW STC SA6019NM. See 337	Maintained in Phoenix, AZ	4762 4808 4840		
	July-0	Installed K2U wing fillets IAW STC SA371CH. Replaced stall warning switch with serviceable. Removed top rotating 8 beacon.		5001		
	September-1 August-1	9 Installed OH'd landin gear transmission. Resealed fuel selector. 0 OH'd fuel selector valve at Webco 2 CW AD 77-13-21 Part A IAW St 782B. Repaired fuel selector. Installed Aeronautical Design Svc Stabilator Horn IAW STC SA04016AT. See 337. CW Ads 75-12-		5107 5214 5504		
		4 06 and 76-07-12 Repaired cabin door lower hinge by installing Webco Doubler	Stabilator Horn STC	5512		
Airframe Log 4	October-1 April-1	6 Part no DK-2 Removed SL-70 transponder and installed Stratus ESG 6 transponder IAW STC SA04112CH. See 337 9 Installed new lift detector 9 Installed new prop control cable		5638 5666 5762 5802		
	May-2	1 Replaced both fuel hoses at boost pump aft of firewall. 5 CURRENT ANNUAL: ELT battery replaced. Expires 5/2027. Engine overhauled at Lycon Inc of Arizona. Reinstalled this engine in Piper PA-24 N8794P. New oil cooler, fuel servo, fuel pump, oil and fuel hoses. New baffle seals installed and Lord		5857 5887		
Engine Log		7 mounts. Patched LH front baffle. Tach 4860.04 Honed cylinder #1 and #2 bores, installed new piston ring sets		0	4860.04	
		8 and reinstalled with new seals. All done under warranty CURRENT ANNUAL: Compressions: 78,77,78,78,78,78. Injectors cleaned and timing inspected. Borescope inspection of 5 cylinders done.		162.96 1026.96		

Propeller Log