

Aircraft Associates
 Notable Aircraft Maintenance History
 1/21/26

Registration	Make	Model	Interior	Tach / AFTT	MGTOW	Empty Weight	Useful Load	CG
N98NT	Piper	1966 PA30B Turbo Twin Comanche			3600	0	0	0
Serial No.	Engine	Paint	Interior	Tach / AFTT	MGTOW	Empty Weight	Useful Load	CG
30-927	IO-320-C1A							
Log	Date Logged	Item(s) Addressed	Critical Item	Tach / AFTT	MGTOW	Empty Weight	Useful Load	CG
Airframe Log 1	December-65	STANDARD airworthiness issued		0				
		No documented logs prior to this date. Appears aircraft sat for some time with minor damage prior to this entry. LH and RH MLG retract links replaced and all struts serviced. NLG dowlock switch replaced. Cowlings sent to Rocky Mountain Straight Flight for repair. Multiple mouse nests removed from under floor and in wings. Heater igniter replaced. Cowl flap hinges replaced. Installed upper door latch IAW STC. Hobbs 1897.0		6198.2				
	January-02	Replaced heater SCAT. Repaired LH and RH horizontal stabilator tips with fiberglass and repainted.		6311				
	December-03	OH'd RH prop governor by Aviation Propellers		6317				
	December-04	Installed doubler to repair crack on forward floorboard.		6388				
	February-08	Aircraft sat since 2011 prior to this date. Flushed all brake fluid. Installed new ACK E-04 ELT. CW pressure decay test on heater. Installed all new fuel caps. Replaced all fluid carrying hoses on both engines and next due October 2025. Installed uAvionics tailBeacon. Welded crack on pitot mast support plate and cleaned corrosion spot on top of RH wing.		6403				
	October-20	Installed 4 new Eagle fuel cells and installed with OH'd fuel senders. Replaced gear mirror. Installed new MLG downlock springs. Installed Degroff sun visors and filed 337.		6412				
	December-20	Installed Phill-Air Shoulder Harness kit IAW STC SA00484W1 and K2U Luggage Door Strut Kit IAW STC SA308CH. See 337.		6428				
	March-21	Installed new Lord engine mounts on both engines, all positions. Installed Garmin GMA345, GNX375, EI CGR30s Engine Gauges, GI275 MFD in place of existing/previous avionics.	Avionics upgrade	6428				
	April-21	Props resealed by Precision Propeller Service. Bungees replaced on MLG. Seats recovered with leather. Installed Delrin flap roller kit.		6491				
	May-23	CURRENT ANNUAL: Heater disabled and labeled INOP. ELT checked and battery due July 2025.		6509				
	July-24							
LH Engine Log	April-99	Engine installed on aircraft		0				
	January-02	First entry. Hobbs 1897		890				
		Installed 2 new ECI Cerminil Cylinders in positions 3 and 4.		1003				
	February-05	Hobbs 2010		1100				
	October-20	Repaired fuel pump. Installed OH'd vacuum pump		1109				
	December-20	Installed new B&C starter IAW STC and OH'd fuel servo and OH'd flow divider. Installed new injector nozzles and new Kelly ignition harness.		1119				
	April-21	Completed 500 hour mag inspection and retimed		1213				
	July-24	CURRENT ANNUAL: Compressions all 70+. ADs checked and oil filter inspected with no metal found.		0				
RH Engine Log	April-99	Engine installed on aircraft		890				
	January-02	First entry. Hobbs 1897		1003				
	February-05	Installed new ECI Cerminil Cylinder in position 3. Hobbs 2010		1045				
	March-07	Installed rebuilt turbocharger from Kelly Aerospace. Hobbs 2052		1100				
	October-20	Repaired fuel pump. Installed OH'd vacuum pump		1109				
	December-20	Installed new B&C starter IAW STC and OH'd fuel servo and OH'd flow divider. Installed new injector nozzles and new Kelly ignition harness.		1119				
	April-21	Completed 500 hour mag inspection and retimed						
		CURRENT ANNUAL: Compressions all 70+. ADs checked and oil filter inspected with no metal found. Removed LH rear cylinder due to ex seat came loose. Installed factory new cylinder with		1213				
LH Propeller Log	July-24	new piston rings, pin and rocker shaft. New spark plug.	Check turbo hose AD timing and ECI applicability	0				
	June-89	Props installed on aircraft		663				
	April-23	Props resealed at Precision Propeller Service. Reinstalled at tach 6480		692				
	July-24	CURRENT ANNUAL: blades checked and hub pressure OK.		0				
RH Propeller Log	June-89	Props installed on aircraft		78				
	January-07	Replaced spinner backplate with new	2039 hobbs	106.5				
	July-10	OH'd RH prop at Mid America Specialized Services						
	April-23	Props resealed at Precision Propeller Service. Reinstalled at tach 6480						
	July-24	CURRENT ANNUAL: blades checked and hub pressure OK.						