



The Standard

AIRCRAFT LOG

ASA-SA-2

Aircraft Record General Information

Manufacturer PIPER Model PA-30
Serial 30-1797 Registration Number N8666Y
Date of Manufacture _____

Engine(s) currently installed:

Manufacturer LYC Model 10-320-B1A Serial 2-5860-55A
Manufacturer " Model " Serial 2-5861-55A

Propeller(s) currently installed:

Manufacturer HARTZELL Model HC-E2VL-2BSE
HUB Model _____ Serial LH, BG4586 Serial RH, BG3066
Blade Model _____ Serial _____ Serial _____ Serial _____
Blade Model _____ Serial _____ Serial _____ Serial _____

DATE	RECORDING TACH TIME LH	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
19/994				
1995 2-7	4543.57		4543.57	<p>BOTH ENGINES MAJ OHV & RE-INSTL, SAME POSITION. PROPS FLUSHED BY ATL, PROP SERV, PROP GOVERNORS OHV BY PIEDMONT AVIATION SERVICES WO# 6267P & 6268P, DATED 1-30-95 SN 4353T INSTL LH & SN 70667 RH (HARTZELL FL-3A) CLEAN & FLUSH OIL COOLERS, LH SNTT-6416 & RH TT-6396. REPAIRED BAFFLES & SEALS, RH FUEL PUMP COOLING SHROUD, WELDED CRACK & RE-INFORCED LH ENG OUT-BOARD EXIT STACK (FORMERLY RH ENG, INB), FABRICATED & INSTL HEAT SHIELDS FOR LOWER ENG MOUNT TUBES, SANDBLASTED, INSP & REFINISHED BOTH ENG MOUNTS. INSTALL IEA NEW ENG LORD MOUNT, RH ENG INTAKE DRAIN VALVE, LH ENG</p>

BOTH VACUUM PUMPS RE-INSTL IN SAME POSITION.

CONT NEXT PAGE

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs Entries must be endorsed with Name, Rating and Certificate Technician or Repair Facility. (See back pages for other specifications)
19 <u>95</u>	LH			NEW SEAL IN RH
CONT 2-7				OIL DRAIN VALVE & ALL FLEX LINES, HOSES & DUCTS. ALSO INSTL NEW LH ENG IN-BD EXHAUST TAIL PIPE HANGAR. <u>Walter F. Ewert</u> AP1373849 (A.I.)
2-13	4544.17		4544.17	A.F.E. GROUND RUN, ADJUSTED & LEAK CHECKED AIRCRAFT IS AIRWORTHY FOR ENG BREAK IN & OIL CONSUMPTION DETERMINATION. <u>Walter F. Ewert</u> AP1373849 (A.I.)
JUNE 9 1995	TACH 4609.92	INSTL NEW		BRAKE LININGS BOTH MAINS <u>Spencer Ewert</u> A0260293059
				CMA - RMG RMG - AHN (P)

DATE 19 _____	RECORDING TAGH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
				RMB - LGC
				LGC - RMG
				RMB - 38J
			4659.0	38J - 735
			4659.7	735 - SSI
	4660.50		4660.50	SSI - LOCAL
	4662.32		4662.32	SSI - RMG
			4664.48	RMG
			4667.02	SSI - RMB
3 AUG 95	4667.02		4667.02	INSTL NEW OUT-BOARD BEARING (QUATONS) IN LH MAIN L.G. WHEEL. INSTL NEW TIRE & TUBE. BALANCE & PAIR BEARINGS. Allen F. Smith API 373849 (A.I.)
8.6	4669.18			SSI

DATE 19 <u>95</u>	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
8-7	4671.86			SS - RMT
8-9	4673.90			RMG - G50
	4674.33			G50 - GAA
8-11			4670.03	GAA - RMG
8-13	4677.93			RMG - SSIT
			468.48	RMG
8-30			4681.33	RMG - CHA - RMG
9-13			4682.07	RMG - LCAW
9-17			4683.17	RMG - BNA
9-17			4684.16	BNA - RMG
9			4685.26	RMG - JUN
			4686.74	JUN - PDK
			4687.31	PDK - RMG
9-23			4688.39	RMG - JUN
9-23			4689.58	JUN - RMG
9-28			4690.24	RMG - LGC

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
19 <u> </u>			4690.55	LGC - CS6 R. HICKMAN. JENKINS 925
0.78			4691.42	CS6 - RWG " "
10-13-95	4691.64	—	4691.64	<p>C/W AD 82-07-03 BY PRES DECAV TEST & 100HR INSP OF CABIN HEATER. INSTL NEW BRUSHES IN COMBUSTION AIR BLOWER MOTOR & NEW HOSE ON FUEL INLET SHROUD. NEXT INSP DUE @ HEATER HR MTR 632.1 (CURRENT 532.1) OR OCT 97. C/W PAR B OF AD 77-13-21 BY INSTL NEW LDG. GERR BUNGEE CORDS. NEXT REPLACEMENT DUE @ TIT 5191.64 OR OCT 98. NEXT INSP PER PAR A DUE @ 5106.71 (S.L. # 782.B). C/W AD 94-13-10 100HR INSP OF STABILATOR FITTING IN AFT FUSELAGE. C/W AD 79-12-08, PAR A, 50HR INSP OF FUEL SELECTOR VALVE. C/W AD 76-18-05 100HR INSP OF V. FIN FWD ATTACHMENT. C/W AD 83-10-01 50HR INSP & CLEANING OF FUEL SELECTOR ^{STRAINERS}. INSTL NEW ENG INDUCTION AIR FILTERS; AD 95-03-02 N/A BY MOD. #.</p>

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
19 95/10/96 11-9	4717.11		4717.11	JUN - RMB
11-16	4720.03		4720.03	RMB - VRB BI FLT, REV L. HARRIN
11-16	4721.60		4721.60	VRB - LOCAL "
11-16	4725.22		4725.22	VRB - RMB "
12-3	4725.72	0.50	4725.72	RMB - LOCAL
12-15	4726.13		4726.13	RMB - LOCAL
12-21				RMB - VPC JUNISTONBURG SYD
12-21	4728.10		4728.1	VPC - ORI W. HAMILTON - MANSLAND
12-21	4729.63		4729.63	ORI - VPC "
12-21	4729.89		4729.89	VPC - CZL "
12-21	4730.12		4730.12	CZL - RMB "
12-27	4731.22		4731.22	RMB - DNL YARN MACHINERY INSP
12-28	4732.46		4732.46	DNL - RMB
12-30	4734.46		4734.46	RMB - WADE (P)
1-1-96	4734.96	0.50	4734.96	WADE - AGS
1-1-96	4736.36	1.	4736.36	AGS - CHA
1-1	4736.87	0.51	4736.87	CHA - RMB

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
19 <u>96</u>				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
1-14	4737.97		4737.97	RMB - JWN B. GRUBBS SPRINGS IND
1-14	4738.98	1.01	4738.98	JWN - RMB " "
1-23	4739.37	0.39	4739.37	RMB LOCAL
2-9-96	4741.99	2.62	4741.99	RMB - M76 WALTER HARDE - BURLINGTON IND
2-9-96	4744.01	2.02	4744.01	M76 - RMB " "
2-13	4745.80	1.79	4745.80	RMB - SUP. C. KENNEDY - GULSTAN CRTS
2-13	4746.24	.44	4746.24	SUP - WS2 " "
2-14	4746.87	.63	4746.87	WS2 - 6AG N. SWEELY - CFA
2-14	4749.18	2.13	4749.18	6AG - RMB " "
2-25	4750.26	1.08	4750.26	RMB - JWN B. GRUBBS - SPRINGS IND
2-25	4751.26	1.00	4751.26	JWN - RMB " "
2-26	4752.22	0.96	4752.22	RMB - CSG H. PARHAM - COLUMBUS MISS
2-26	4753.11	0.89	4753.11	CSG - RMB R. HICKMAN " "
3-12-96	4753.11		4753.11	REPAIRED NOSE COWLS (L & R) INSTALLED NEW HINGES & PINS. PRIMED W/ DUPONT URO PRIME. METAL COWL PIECES STRIPPED, ETCHED, ALUMINIZED & PRIMED W/ ALUMINUM \$9001 & ALL COWL END OF FIREWALL TOP COATED W/ SET GLOW. <u>Walter G. Everett</u> AA1373849 (A-1)

DATE 19 <u>96</u>	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)
4-28	4780.45	1.75	4780.45	SPV - RMB
5-1	4781.51	1.06	4781.51	RMB - JUN
5-1	4782.53	1.02	4782.53	JUN - RMB
5-3	4784.00	1.47	4784.00	RMB JYL - PENNSYLVANIA YARN MIKE SMITH
5-3	4785.00	1.00	4785.00	JYL - SSI
5-4	4786.87	1.87	4786.87	SSI - RMB
5-15	4787.90	1.03	4787.90	RMB - JUN (SPRINGS DR) BIRGERS
5-15	4788.95	1.05	4788.95	RMB - JUN
6-1	4790.15	1.20	4790.15	RMB -
6-1	4791.32	1.17	4791.32	- RMB
6-2	4792.50	1.18	4792.50	RMB DNL (PLBARS - BURLINGTON)
6-2	4793.71	1.21	4793.71	DNL - RMB
6-4	4794.44	0.73	4794.44	RMB - LGC INTERFACE - D. HARRIS
6-4	4795.13	0.69	4795.13	LGC - RMB
6-10	4797.42	2.29	4797.42	RMB - LOU
6-10	4798.92	1.50	4798.92	LOU - MDW
6-12	4802.12	3.12	4802.12	MDW - RMB

DATE 19 <u>76</u>	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
6-13	4802.62	0.50	4802.62	RMG - FTY GEOFF SCOTLAND DRAKE FIBRES
6-13	4803.81	1.19	4803.81	FTY JUL MIKE SMITH SYLVANIA YARD
6-13	4805.39	1.58	4805.39	JYL - FTY " " "
6-13	4805.86	0.17	4805.86	INSTL NEW TIRE RH, BALANCE + PK BRGS, INSTL FTY - RMG " " "
6-18	4807.70	1.84	4807.70	RMG - VUJ NELSON SWEET CTA YARDS
6-18	4809.59	1.89	4809.59	VUJ - RMG " "
6-23	4811.73	2.14	4811.73	RMG - IEX (P)
6-23	4813.92	2.19	4813.92	IEX - RMG (P)
6-30	4815.03	1.11	4815.03	RMG - JWN (P)
6-30	4816.04	1.01	4816.04	JWN - RMG (P)
7-2	4818.41	2.37	4818.41	RMG - LLQ BURLINGTON WALT. THAPE
7-2	4820.53		4820.53	LLQ - RMG " "
7-8	4820.99	0.46	4820.99	RMG - CVA (SYMPUS DIXIE YARDS) 40 INC
7-8	4821.71	0.72	4821.71	CVA RMG " " 7 INC ICS APP.
7-11	4823.68	1.97	4823.68	RMG - ROA R.L. BARNES BURLINGTON
7-12	4824.59	1.01	4824.59	ROA - Rie " "
7-12	4827.88	3.19	4827.88	Rie - RMG S. CAROL ASSOC 40 INC OIL ONLY

IN-STA BRG C/P
 2-7-76

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
19 <u>96</u>				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
7-22	4829.33	1.45	4829.33	RMG - 9A1
7-23	4830.02	0.69	4830.02	9A1 - RMG
7-26	4831.12	1.10	4831.12	RMG - JWN
7-27	4833.11	1.99	4833.11	JWN - LIT
7-27	4835.51	2.40	4835.51	LIT - RMG
8-2	4837.84	2.33	4837.84	RMG - SSI
8-7	4839.88	2.04	4839.88	SSI - RMG
8-8	4841.97	2.09	4841.97	RMG - GSO
8-8	4843.95	1.98	4843.95	GSO - RMG
8-10	4848.04	2.09	4848.04	RMG SSI
8-12	4848.04	2.00	4848.04	SSI - RMG
8-19	4850.11			RMG - SSI
8-19	4850.98			SSI DBN
8-19	4852.19			DBN - RMG
8-21	4853.12			RMG - CSB
8-21	4853.46	1.01		CSB - LGC

Alton F. Emmitt AP1373849 (A1)
 INSTL NEW STAND-BY HORSE
 4 SEALS IN LH BRAKE WHL C/L

1.88 INC
 2.33 INC

1.55 INC
 1.62 INC

2.0 INC
 (JMCALUM, APKEX02 - BUREAU)
 1.69 INC

2.0 INC

1.95 INC

INSTL NEW BRAKE DISC & LININGS, ATR
 Alton F. Emmitt AP1373849 (A1)

17CS RTR

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
19 96				
8-21	4854.13			RMB - RMB
8-24	4856.04			RMB - SSI
8-25	4868.02			SSI - RMB
9-10	4858.89			RMB - LOCAL
9-11	4860.12			RMB - DNL
9-11	4861.32			DNL - RMB
9-18	4862.20			RMB - 18A
9-18	4863.05			18A - RMB
9-19	4864.11			RMB - JWD (B. GRUBBS - SPRINGS IN) IGEA, R+L
9-19	4865.			" "
9-21	4866.09			RMB - AND - (ALL STATES MACH - J. WICKS)
9-21	4866.72			AND - 9AD (D SILCOX - BURLINGTON)
9-30	4869.28			9AD - RMB
9-30	4869.28			RMB - FLO E WHITTINGTON WORKMAN ILS APP 18 IMC
9-30	4871.16	1.88	4871.16	FLO - RMB
10-1	4873.06	1.90	4873.06	RMB - SAV
10-1	4873.56	.50	4873.56	SAV - SSI

DATE 19 96	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)
10-1	4875.56	2.0	4875.56	SSI - RMG ^{19 time} (M. Evers CWK) INT LOG 115 APP
10-2	4878.34	2.78	4878.34	RMG PGV (ASPHEN KARRASOM) 22 INT LOG
10-2	4880.09	2.75	4881.09	PGV - RMG (" ")
10-5	4883.39	2.30	4883.39	RMG - ROA (M. Evers CWK)
10-5	4885.47	2.08	4885.47	ROA - RMG (" ")
10-9	488			RMG -
10-12	4887.34			RMG -
10 -	4888.44			RMG - JUN
10 -			4889.50	JUN - RMG
10-18				RMG DNL
10-20	4892.01		4892.01	DNL - RMG
10-20			4	RMG - 7A5 (To CAMMER 4A25/CWAL)
10-21	4893.43		4893.43	7A5 - RMG (" "
10-24	4895.95		4895.95	RMG - 6A6 (C+A YARUS - N. SWEEP)
10-25	4897.23		4897.23	6A6 - ROA (BURLINGTON IND - B. McAYERS)
10-27	4900.41		4900.41	ROA - RMG (" "
10-29	4900.91	0.50	4900.91	RMG - CHA (D. MARLOWE - DNA IND)

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
19 96				
10-29	4901.39	0.48	4901.39	CUA - RMG (D. MARLOWE - SMA)
12 NOV 96	4901.52		4901.52	
				<p>INSTALL NEW ENG INDUCTION AIR FILTER ELEMENTS (BRACKET) AD 95-03-02 N/A BY MOD. NO., VACUUM REG. FILTERS, BOTH MANIFOLD DRAIN VALVES, MAN ON 492-09, ON LH ENG, NLG TIRE & TUBE, RH MLG AXLE, RH BRAKE FLEX LINE, SEALS IN RH MLG STRUT, RH ENG OUT-BD EXH TAIL PIPE HANGAR & G-35 BATTERY, CABIN HEATER FUEL PRES. REGULATOR & SPARK PLUG. (NEXT HEATER INSP PER AD 82-07-03 DUE @ HTR HR MTR 632.1 OR OLT 97 - CURRENT HTR HR MTR 564.7, WELDED CRACK AT FLANGE & REINFORCED #1 CYL EXH STACK LH ENG. STRIP, ETCH, ALODINE, PRIME & REFINISH RH MLG KNEE, C/W AD ROTATED LH MLG TIRE ON WHEEL, C/W AD 95-20-07 BY INSTALLING NEW AN 22512-000 STUDS, LTR, WITH NEW 14843-030 BUSHINGS. NEXT INSP DUE IN 1000.0 HR OR A.C.T.J.</p>
	5901.52			CONT NEXT PAGE

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
19 CONT 17 NOV 96				
INSTALLED EXTERNAL GPS ANTENNA (GARMIN GA-56) TOP FUSELAGE @ STA 101.5. WEIGHT CHANGE NEGLECTABLE.				<p> G/W AD 77-13-21, PARA A, PER PAC SB# 782 B (LOG GEAR SYS WEAR INSP) NEXT INSP DUE @ A/C T.T. 5901.52. PAR B OF AD (SHOCK CORD REPLACE) NOT G/W - NEXT DUE @ T.T. 5191.64 OR OCT 98. G/W AD 94-13-10 100 HR INSP OF STABILATOR FITTINGS IN RT FUSELAGE G/W AD 79-12-08, PARA A, 50 HR INSP OF FUEL SELECTOR VALVES. G/W AD 76-18-05 100 HR INSP OF V. PIN FWD ATTACHMENT. G/W AD 83-10-01, 50 HR INSP & CLEANING OF FUEL STRAINERS. AD'S CHECKED THRU 96-21, TACH 4901.52 T.T. 4901.52 </p> <p style="text-align: right;"> I CERTIFY THAT THIS AIRCRAFT HAS BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND WAS DETERMINED TO BE IN AIR WORTHY CONDITION </p> <p style="text-align: right;"> <u>Alton J. Farnett</u> AP1373849 AUTHORIZED INSPECTOR </p>
	11-15-96		.80	
11-15-96	4904.16	.81	4904.16	LGE - RMG " "

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
21 NOV 96				REMOVE MAN. PRES. GAGE SN 4-1637 & INSTL OHV UNIT, PN 6121E58, SN 173422 BY PRECISION AVIONICS, INC, WO 52059, DATED 11-19-96
	4904.17	—	4904.17	Altitude Error AP 1373849 (A.)
21 NOV	4904.60	0.43	4904.60	RMB - LOCK
Nov 21	4906.68	2.08	4906.68	RMB - RDU (N SWEET CAA)
Nov 21	4909.68	3.00	4909.68	RDU - RMB
DEC 2	4911.76	2.08	4911.76	RMB - RDU N SWEET CAA
Dec 2	4912.24	0.48	4912.24	RDU - GSO A. PARKER BURLINGTON
Dec 2	4912.84	0.60	4912.84	GSO - IGV
Dec 3	4913.46	0.62	4913.46	IGV - MTV G. SCHURICA - DRAKE
Dec 3	4915.89	2.43	4915.89	MTV - RMB
12/9	4917.29	1.40	4917.29	RMB JYL MSMTM SYLVANIA YARNS
12/9	4918.95	1.66	4918.95	JYL - RMB
12/20	4920.07	1.12	4920.07	RMB - JWN (P)
12/20	4921.13	1.06	4921.13	JWN - RMB (P) AND 1 QT REPLE NT LOG

DATE 19 <u>97</u>	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
1/3/97	4923.23	2.10	4923.23	RMB - RDU NSUREZY - C+A YARNS
1/3	4923.91	0.68	4923.91	RDU GAB " "
1/3	4926.09	2.18	4926.09	GAB - RMB " "
1/	4927.20	1.11	4927.20	RMB - JWN B GROBBS - SPRINGS MILLS
1/	4928.30	1.10	4928.30	JWN - RMB " "
1/20	4929.11	0.81	4929.11	RMB - LOCAL
2/05	4930.15	1.04	4930.15	RMB - LOCAL
2/7	4931.07	.92	4931.07	RMB - CSG (H PARHAM COCOMBUS MILLS)
2/7	4931.92	.85	4931.92	CSG - RMB " "
2/18	4932.53	0.61	4932.53	RMB - LOCAL
2/24	4933.18	0.65	4933.18	RMB - LOCAL
2/28	4934.23	1.05	4934.23	RMB - BNA (P) 1 NIGHT ILS (P) 1.0 ILS
3/2	4935.48	1.25	4935.48	BNA - RMB (P) INT LOG. 1.1 ILS
3/11	4936.17	0.69	4936.17	RMB - LOCAL
3/17	4937.25		4937.25	RMB - CSG (R. HICKMAN - C'BUS MILLS)
3/17	4937.59		4937.59	CSG - LGE (D. HUBBS - I'FACE)
3/17	4938.27		4938.27	LGE - RMB " "

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
19 97				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
3/24	4938.84	0.60	4938.84	RMG - ASN (TALOGGA TEST MACH - J. PETERS)
3/24	4939.43	0.59	4939.43	ASN RMG
3/24	4941.66	2.23	4941.66	RMG - LLO (R. BARNES - BURLINGTON, INJ)
4/1	4943.93	2.27	4943.93	LLO - RMG " "
4/2	4947.24	3.31	4947.24	RMG - DEA
4/3	4949.41	2.17	4949.41	DEA - RDU
4/7	4952.32	2.91	4952.32	RDU - RMG 15W-50 / AY BLEND OIL & FILTER CHANGE
4/10	4953.00	0.68	4953.00	RMG - TOL INSP MACH - SLOW INJ
4/10	4953.47		4953.47	TOL GMU TEST MACH SLOW
4/10	4954.87		4954.87	GMU ROA MAINTENANCE MCH. BURLINGTON
4/11	4957.27		4957.27	ROA DNL "
4/12	4958.70		4958.70	DNL - RMG "
4/15	4960.09		4960.09	RMG - TRI MACH MCH. BURLINGTON
4/15	4961.48		4961.48	TRI RMG "
4/18	4963.58		4963.58	RMG - CRE (M. CURRIS CURTIS WOOL)
4/18	4964.89		4964.89	CRE - GSO (A. PARZER - BURLINGTON)
4/18	4966.98		4966.98	GSO - RMG (" ") ADD 1 OIL RE + 1 OIL LE

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
1997				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
4-20	4968.93	1.55	4968.93	RMG - CRE M. EVANS - CUMS WOOD
4-20	4969.75	0.83	4969.75	CRE - JZI " " "
4-21	4970.34	0.59	4970.34	JZI - 38J E WHITTINGTON - WELLMAN
4-21	4971.80	1.46	4971.80	38J - AND " "
4-21	4972.85	1.05	4972.85	AND - RMG " "
4-25	4974.00	1.15	4974.00	RMG - GSP H ORTMAN - RENTEX
4-26	4975.43	1.43	4975.43	GSP - RMG 1 ILS APP
5-15	4975.43	-	4975.43	RMG VOYR NAV 1 3500 NAV 2 3470
5-15	4976.31	0.88	4976.31	RMG - LOCAL
5-19	4978.49	2.18	4978.49	RMG - MOB (R'DENKSET - MASANS) 1 ILS APP 2.0 IMC
5-19	4980.50	2.01	4980.50	MOB - RMG " " 1.9 IMC
5-21	4981.18	0.68	4981.18	RMG - LGL (D. HOBBS INTERLINE)
5-21	4981.88	0.70	4981.88	LGL - RMG " "
5-29	4983.97	2.09	4983.97	RMG - SSI 1.89 IMC
5-31	4985.83	1.86	4985.83	SSI - RMG 1.80 IMC 1 QT PREV
6-3	4988.08	2.25	4988.08	RMG - LLQ (RL BARNES - BFI)
6-3	4990.39	2.31	4990.39	LLQ - RMG (D RYAN - BFI)

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
19 97				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
6-7	4991.48	1.09	4991.48	RMG - MGM WILLIAMS 1.0 - IMC
6-7	4992.58	1.10	4992.58	MGM - RMG " 1.0 IMC ^{1.0} RE+LE
6-9	4995.61	3.03	4995.61	RMG - CGX MEDCON 2.95 IMC
6-11	4999.18	3.57	4999.18	CGX RMG " 3.25 IMC
6-12	5000.49	1.31	5000.49	RMG - TRI (WOOL YARNS SP R#12) 1.25 IMC
6-12	5002.13	1.64	5002.13	TRI - RMG " " 1.55 IMC
6-15	5004.14	2.01	5004.14	RMG - SSI
6-17	5006.52		5006.52	SSI - RMG IMC 1.25 APPROX
6-19	5008.51	2.01	5008.51	RMG - SSI
6-22	5010.68	1.83	5010.68	SSI - RMG
6-23	5011.57		5011.57	RMG - CSG (HARVARD COCAINUS MICS)
6-23	5012.45		5012.45	CSG - RMG " ADD 1 QT RE+LE
6-24	5014.59		5014.59	RMG SSI
6-27	5016.71		5016.71	SSI - RMG
6-29	5018.66		5018.66	RMG - SSI
6-30	5020.70	2.04	5020.70	SSI - RMG
7/5	5022.30	1.60		RMG - LEA

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
1997 7/5	5023.91		5023.91	LET-RMG
7/18	5025.64		5025.64	RMG-IGX
7/18	5027.64		5027.64	IGX-RMG
7/20	5029.14	1.50	5029.14	RMG-IGX
7/20	5031.49	2.35	5031.49	IGX-RMG
8/1	5033.88		5033.88	RMG-IGX
8/1	5035.96		5035.96	IGX-RMG
8/3	5038.22		5038.22	RMG-IGX
8/3	5040.40		5040.40	IGX-RMG
8/4	5041.35	0.95	5041.35	RMG-LQK
8/4	5042.34	0.99	5042.35	LQK-RMG
8/4	5043.34	1.00	5043.34	RMG-LQK
8/4	5044.20	0.86	5044.20	LQK-RMG
8/7	5045.67	1.47	5045.67	RMG-AKH M. CRAPT + PHARR/DRAKE
8/7	5047.15	1.48	5047.15	AKH-RMG
8/8	5048.71		5048.71	RMG-TMA (WOOLYARNS/GREENSPIN)
8/8	5050.17		5050.17	TMA-RMG

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
19 97				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
8/9	5052.18	2.01	5052.18	RMG-73J
8/10	5054.05	1.87	5054.05	73J - RMG
8/11	5051.54		5051.54	RMG - 73J FTY
8/11	5056.12		5056.12	FTY - 73J
8/12	5057.94	1.82	5057.94	73J - RMG
8/13	5059.70		5059.70	RMG - 73J
8/13	5061.47			73J - FTY
8/13	5061.97	0.50	5061.97	FTY - RMG
8/14	5061.97	Installed NEW BRAKE LININGS - INBOARD LININGS ON BOTH SIDES Bill Tracy AEP 31356676		
8/21	5064.60	2.63	5064.60	RMG - VPC RPA (J. WITTENBURG / B. McHAUL - BI)
8/21	5066.75	2.15	5066.75	RPA - VPE - RMG
8/24	5067.69	0.94	5067.69	RMG - ILY S. HAMMOND
8/24	5068.60	0.91	5068.60	ILY - RMG
8/25	5069.13		5069.73	RMG - JWN
8/25	5070.75		5070.75	JWN - RMG
8/27	5071.55		5071.55	RMG LGC

INT LOG

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
19 97				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
8/27	5072.00	1.05	5072.60	LGC - ILY
8/27	5073.49	0.89	5073.49	ILY - RMB
9/08	5074.67	1.18	5074.67	RMB - JUN
9/08	5075.74	0.93	5075.74	JUN - RMB
9/14	5076.89	1.15	5076.89	RMB - JUN
17 SEP 97	5078.18	—	5078.18	INSTL OHV ADG. GEAR ACTUATOR MOTOR BY WEBCO, PN 2186-000, NO SN.
		—		Alter 7. ECUOT AP1373849 (A.I.)
9/14	5078.18	—	5078.18	JUN - RMB INT LOG 1.0 TMC (GR ON FLT)
9/18	5080.30	2.12	5080.30	RMB RMA BI
9/18	5082.57	2.27	5082.57	RMA - RMB
9/24	5083.67	1.10	5083.67	RMB - GMU SACU LOW 1 FLS LOG
9/24	5084.99	1.32	5084.99	GMU - RMB
9/28	5086.88	1.89	5086.88	RMB - SSI 1.5 TMC
9/30	5089.35	2.47	5089.35	SSI - RMB INT LOG 2.0 TMC 1 REFILE
10/4	5092.42	3.07	5092.42	RMB - OKV 2 OCT 97 TACH 5089.35 INSTL NEW BATTERY RELAY Alter 7. ECUOT AP1373849
10/5	5095.54	3.12	5095.54	OKV - RMB

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
19 97				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
10-6	5097.84	2.30	5097.84	RMG - RDU McCURTIS - CURTIS WOOD 2,1 INK
10-6	5098.88	1.04	5098.88	RDU - 38J E. WHITTENBEN WELLMAN
10-6	5100.85	1.97	5100.85	38J - RMG " "
10-10	5102.03		5102.03	RMG - JWN BRADY GRUBBS SPRING MILLS
10-10	5103.18		5103.18	JWN - RMG " "
10-16	5109.33		5109.33	RMG - CHA TF RING 2 FOR 346 # 2 FOR 347
10-16	5104.35		5104.35	CHA - RMG TF
10-18	5105.50		5105.50	RMG - JWN B GRUBBS SPRING MILLS .9 INK
10-18	5106.49		5106.49	JWN - RMG INT. LOG " " .85 INK
10-22	5108.54	2.05	5108.54	RMG - IGX G. SCHOFIELD - DRAKE HB 2.0 INK
10-23	5109.33	2.05	5109.33	IGX JQF B. PARK - WISCASET MILLS
10-23	5110.01		5110.01	JQF - IGX " "
10-24	5112.61		5112.61	IGX - RMG INT. LOG " " (ADD LOG 28 LETTER) INK
10-31	5114.50		5114.50	RMG - 73J
10-31	5117.15		5117.15	73J - JWN
10-31	5118.53		5118.53	JWN - MORZ
11-2	5120.11		5120.11	MORZ - BNA

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
1997				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
11-2	5121.11		5121.11	BNA-RMG 1 NT LOG
11-3	5122.81		5122.81	RMG-73J
11-3	5123.58		5123.58	73J-SSI
11-3	5125.61		5125.61	SSI-RMG
11-4	5126.30		5126.30	RMG-BHM
11-7	5128.11		5128.11	BHM-DNL 1 NT LOG
11-7	5129.11	1.0	5129.11	DNL-CHS 1 NT LOG
11-9	5130.10		5130.10	CHS-DNL
11-9	5132.32		5132.32	DNL-JWN
11-9	5133.31		5133.31	JWN-RMG 1 NT LOG
11-16	5136.34		5136.34	RMG-VRB
11-17	5137.96		5137.96	VRB-LOCAL
11-17	5141.51		5141.51	VRB-RMG 1 NT LOG
11-18	5142.38		5142.38	RMG-LQK
11-18	5143.00		5143.00	LQK-CZL
11-18	5143.44		5143.44	CZL-RMG ADD 1 QT RETLE
11-19	5144.58		5144.58	RMG-JWN

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
19 97				
11-26-97	5145.62	1.04	5145.62	JUN - RMG S. MOSS INSTL NEW BRUSHES IN HEATER
11-26-97	5145.72	1.0	5145.72	COMBUSTION AIR BLOWER MTR. QW 28.7, E. MOSS
11-26-97	5147.55	1.83	5147.55	RMG SSI
11-29	5149.95	2.40	5149.95	SSI RMG 2.3 IMC ILSAP TOWND
12-19-97	5150.16		5150.16	INSTALLED FRESH ELT BATTERY W/ REPLACE DATE DEC 99 & INSP PER FAR 91.207, (D), (1-4). AD 97-01-01 M&G SIDE BRACE STUD INSP - NEW PN 22512-000 STUDS & PN 14843-030 BUSHINGS INSTL 12 NOV 96 @ 4901.52 - NEXT INSP DUE @ 5901.52. C/W AD 96-20-07 (S) 582-07-03) ON CABIN HEATER, PRES DELAY TEST & INSP OF COMBUSTION AIR SWITCH PER MAINT & OHV MANUAL, PN 24825-1, DTD OCT 81 - NEXT DUE @ HEATER HR. MTR 728.7 OR DEC 99. C/W AD 94-13-10 100 HR INSP OF STABILATOR FITTINGS IN AFT FUSELAGE. C/W AD 83-10-01, 50 HR INSP & CLEANING OF FUEL STRAINERS. C/W AD 79-12-08, PARA A, 50 HR INSP OF FUEL SELECTOR VALVES. C/W AD 77-13-21, PARA B, INSTL NEW SHOCK CORDS - NEXT DUE @ 5650.16 OR DEC 2000 - PARA

HEATER HR. MTR 728.7
T-50 628.7

ELECTRICAL

CONT NEXT PAGE

CONT 19 DEC 97

DATE 19 _____	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
				<p>SYSTEM WEAR INSP, DOE @ 5901.52. AD'S CHECKED THRU 97-24. INSTL NEW TIRE LH MAIN, NEW LH OUT-BD FUEL CAP, IN-BD BEARING CUP & CONE IN RH M.I.G. WHEEL, ROD END BEARINGS, AFT END OF L & R AILERON PUSH-PULL RODS AND OHV (BY AIR PARTS OF HOCK HAVEN, WO # 96-3320, 10-16-96) WING FLAP POSITION TRANSMITTER PN 22663-00. REPAIRED TRIM ROD SLOT RADISUS (TOP & BOT) OF TAIL CONE. REPAIR & REFINISH BOTH WING & STABILATOR TIPS AND VERTICAL FIN CAP. STRAIGHTENED BOTH WING NAV LITE COVERS & SOCKETS & REPAINTED.</p>
LH TACH	5150.16			<p>I CERTIFY THAT THIS AIRCRAFT HAS BEEN INSTL FRESH INSPECTED IN ACCORDANCE WITH AN ANNUAL BRACKET BA-10 AIR WORTHY CONDITION BE IN ENG. IND. AIR FILTERS.</p> <p><i>Alton F. Everett</i> AP1373849 AUTHORIZED INSPECTOR</p>
T.I.	5150.16			

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
19 97				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
12/19	5151.57	1.09	5151.57	RMG - JUN
12/19	5152.61	1.04	5152.61	JUN - RMG / NT LG
1-3-98	5154.38	1.77	5154.38	RMG - MEM
1/3	5155.99	1.61	5155.99	MEM - RMG
1/4	5157.79	1.80	5157.79	RMG - MEM
1-7-98	5159.36		5159.36	INSTL NEW RH PROP CONTROL <i>Alton F. Burrell</i> AP1373849(A.I.)
1/4/98	5159.36	1.60	5159.36	MEM - RMG
1/8/98	5161.44	2.08	5161.44	RMG - SSI
1/8/98	5163.25	1.81	5163.25	SSI - RMG
1/10	5165.35	2.10	5165.35	RMG - SSI
1/10	5167.58	2.13	5167.58	SSI - RMG
1/25/98	5168.12	0.54	5168.12	RMG - CHA - RMG
1/25				CHA - RMG
1/30	5169.33	1.21	5169.33	RMG - JUN
1/30	5170.30	0.97	5170.30	JUN - RMG
1/30	5171.48	0.18	5171.48	RMG - DNL
1/30	5172.71	1.23	5172.71	DNL - RMG

DATE 19 <u>98</u>	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
2/1	5173.92		5173.92	RMG-DNL
2/1	5175.06	1.14	5175.06	DNL RMG
2/1	5176.13	1.07	5176.13	RMG-JWN
2/1	5177.22	1.09	5177.22	JWN-RMG
2/10	5179.00	1.78	5179.00	RMG-GSO (BURLINGTON - AMCOR) INT LDG
2/10	5181.06	2.06	5181.06	GSO-RMG " "
2/13	5181.94	0.88	5181.94	RMG-CSG - 0.8 IME
2/13	5182.83	0.89	5182.83	CSG-RMG - COLUMBUS Miles (Hickman, Parrott)
2/23	5184.17	1.34	5184.17	RMG-DBN (.9 IME) (B. HURTON - MORAWICK INC)
2/23	5185.62	1.45	5185.62	DBN-RMG (1.3 IME) ILS LDG
3/1	5186.59	0.97	5186.59	RMG-BNA
3/1	5187.66	1.07	5187.66	BNA-RMG
3/22	5188.42	0.76	5188.42	RMG LOCAL
4/4	5189.50		5189.80	RMG BNL
4/4	5191.52		5191.52	BNL Rmg
4/11	5194.22		5194.22	RMG-PGV (M. CURTIS (WOOD))
4/11	5196.01		5196.01	PGV-DNL " "
4/13	5197.52		5197.52	DNL-RMG " " (GATE DOWN)

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
19 98				
16 APR	5197.52		5197.52	INSTL NEW MLG (LXR) DOWN SWITCHES + LDG MOTOR RELAY. ALSO INSTL SEALS TRING ON ORFICE TUBE, LH MLG. LDG RETRACTION OK. Alton F. Ewert A#137384.9 (A.I.)
4/21	RMG 5198.42		5198.42	RMG - CSG ROSSI + PARHAM COCONUTS MILCS .75 DMC
4/21	5199.53	1.11	5199.53	CSG - CHA " " .90 DMC
4/21	5199.96	0.43	5199.96	CHA - RMG STAR AVIONICS CHA
4/25	5202.07	2.11	5202.07	RMG - IBX
4/25	5204.26	2.21	5204.26	IBX - RMG
4/26	5206.19	1.93	5206.19	RMG - SSI
4/26	5208.14	1.95	5208.14	SSI - RMG
4/27	5210.83	2.69	5210.83	RMG - RIC (R. BARNES / B. McPHAN B.T. ILS 25 DMC
4/27	5211.85	1.02	5211.85	RIC - ROA " "
4/28	5214.00	2.15	5214.00	ROA - RMG " "
5/5	5215.09	1.09	5215.09	RMG - BNA .65 DMC

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
19 98				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
5-2				RMA RMG
5-2	5216.5	1.41	5216.5	RMG AUN
5-3	5217.39	0.89	5217.39	AUN RMG
5-6				RMG-SSI
5-6			5221.21	SSI - RMG
5-12			5223.14	RMG - SSI
5-12			5225.17	SSI - RMG
5-20			5227.15	RMG - ROA ? BURLINGTON / MURCHISON
5-20			5229.33	ROA - RMG " BARNES
5-22				RMG - ROU
5-22			5234.16	ROU - RMG
5-25			5236.30	RMG - ROU NISWERT - McELROY YARNZ
5-26			5237.	ROU - FOD P. McELROY " "
5-26			5238.95	FOD RMG " "
5-30			5239.83	RMG - MQY
5-30			5240.88	MQY - RMG
5-31			5241.90	RMG - MQY

DATE 19 <u>98</u>	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
5-31			5242.77	M04 - RMG
6-6			5244.52	RMG - SSI
6-7			5246.63	SSI - RMG
6-8			5249.72	RMG - CBX NEOLON
6-10			5252.75	CBX - MKC
6-16			5256.09	MKC - RMG
6-14			5257.43	RMG - JUN
6-14			5258.49	JUN - RMG
6-17			5259.16	RMG - LGC (D) HUBBS - INTERFACE
6-17		0.64	5259.80	LGC - RMG " "
6-20			5260.91	RMG - BNA
6-20			5262.42	BNA - AVL
6-21			5264.22	AVL - BNA
6-21			5265.12	BNA - RMG
6-23	5265.12		5265.72	CHV BOTH BRAKE MASTER CYL. API 373849 (AVL) <i>William F. Brown</i>
6-24	5269.00		5269.00	RMG - VUT J. MONTGOMERY - MASTER/REP
6-24	5271.00		5271.00	VUT - RMG " "

DATE 19 <u>98</u>	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
6-26			5272.10	RMG - JUN
6-26			5273.16	JUN - RMG
6-28			5274.23	RMG - JUN
6-28			5277.15	JUN SSI
7-6			5291.60	SSI RMG INSTL NEW RH LDG LITE LAMP W/ E. API 373849 (R.I.)
7-11			5293.77	RMG - IOX
7-11				IOX - SSI
7-13			5285.20	SSI - RMG
7-16			5286.37	RMG JUN
7-18			5287.40	JUN - RMG
7-24			5289.22	RMG - VUJ
			5152.18	VUJ - FTY
			5291.63	FTY - RMG
7/29				GLASSO (SS) - AQUATIC
7/29				N. SWARTZ - NAWOOD
7/29				J. THOMPSON CFA ADD
7/29				RMG - SSI
7/29				SSI - RMG
7-27			5296.19	INSTL NEW TIRE & TUBE RH MAIN W/ E. API 373849 (R.I.)
7-29			5298.04	RMG - SSI

DATE 19 <u>98</u>	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
7-29			5300.28	SSI - RMG
8-4		2.2	5302.48	RMG - ROA D MARCONE - AQUAFIL 2.0 INC
8-4		2.13	5304.61	ROA RMG B HUTCHISON JYD) RT 1.9 INC
8-10		1.07	5305.68	RMG - ESG H PARHAM COCUMBER MILLS
8-10		1.45	5307.13	ESG - SSI
8-17		1.98	5309.11	SSI - RMG
8-			5311.24	RMG - SSI
8-24			5313.14	SSI - RMG
8-28			5313.4	RMG - DWN SLAW INC
8-28			5315.30	DWN - IGX
8-28			5317.54	IGX - RMG
8-30			5319.80	RMG - IGX
8-30			5321.87	IGX - RMG 2.0 INC INT LOG
9-20			5323.90	RMG - SSI
9-20			5325.25	SSI - RMG
9-22			5327.67	RMG - SSI
9-22			5329.74	SSI - RMG

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)
19 98				
9-25			5330.15	RMG - CHA . . STAR AVIONICS REP 1K155
9-25			5330.58	CHA - RMG + RE-INSTALL STORMSCOPE
9-30			5330.58	INSTL NEW WEBLO FUEL CAPS, BOTH MAINS & RH AUX. AP1373849(A)
10-2			5332.43	RMG - SSI
10-2			5333.60	SSI - DNL
10-4			5334.82	DNL - RMG
10-6			5335.89	RMG - JUN
10-6			5336.97	JUN - RMG
10-9			5338.15	RMG - ROA (BURLINGTON - McParr)
10-9			5339.94	ROA - IGX
10-10			5339.94	IGX - PGV CURAS WOOD M.M. CURAS
10-10			5343.34	PGV - RMG CURAS WOOD - M.M. CURAS
10-17			5344.65	RMG - DNL
10-18			5345.86	DNL - RMG
10-22			5347.59	RMG - SSI
10-22			5349.8	SSI - RMG
10-28			5351.2	RMG - VTI

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
10-28			5352.72	VJI - RMG
10-30		.76	5353.38	RMG - LGC (D. HOBBS - I'GAGE FRG)
10-30			5355.36	LGC - VJI
10-30			5357.10	VJI - RMG
10-31			5358.70	RMG - SSI
11-2			5360.81	SSI - RMG
11-13			5361.45	RMG - LOCAL
11-29			5363.38	RMG - SSI
11-29			5365.130	SSI - RMG
12-4			5367.25	RMG - SSI
12-6			5369.15	SSI - RMG
12-9			5369.59	RMG - CIA (STAR WIONICS - 2 P.T.)
12-9			5370.02	CIA - RMG (SWITCHES/NEW MIKE)
12-10			5371.19	RMG - ABS
12-10			5372.52	ABS - RMG
12-14			5373.83	RMG - DNL
12-15			5374.90	12-14 DNL - RMG 5374.90
12-15			5376.87	RMG - MOB RMG (MASLOW - MALCOLM - DENVER)
12-15			5378.8	MOB - RMG

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)
19 99	5378.8	—	5378.8	INSTL NEW BRAKE DISC & LININGS
				BOTH SIDES, RH ENG OUT-BD EXH TAIL PIPE HANGAR CLAMP, LH ENG OUT-BD HANGAR STOLAP, RH PROP
				SPINNER BALC PLATE (BULKHEAD), HEATER COMBUSTION
				AIR BLOWER MOTOR AND RH DILERON OUT-BD
				HINGE BEARING. ^{ALSO BRACKET ENG AIR FILTER ELEMENTS.} ROTATED LH MAIN TIRE ON WHEEL.
				INSP ELT PER FAR 94.207, (2), (1-4) - BAT REPLACE
				DATE DEC 99. C/W AD 94-13-10, 100 HR INSP OF STABILATOR
				FITTINGS IN APT FUSELAGE. NEXT M & G SIDE BRACE
				STBD INSP. PER AD 97-01-01 R1 DUE @ 5901.52. NEXT INSP
				OF CABIN HEATER PER AD 96-26-07 DUE @ HEATER HR MTR
				728.7 OR DEC 99. C/W AD 98-04-27 ICING WARNING BY
				INSTALLING COPY OF AD IN FLT. MANUAL
				C/W AD 83-10-01 50 HR INSP & CLEANING OF FUEL
				STRAINERS. C/W AD 99-12-05, PAR A, 50 HR INSP
				OF FUEL SELECTOR VALVES. NEXT LDG GEAR
				SHOCK CORD REPLACE PER AD 77-13-21, PAR B

HEATER HR MTR 675.0
 T 50 675.0

DATE 19 <u>79</u>	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)
7 JAN			5379.88	RMB - LOCAL
10 - 1			5381.40	RMB - 88 J
10 "			5383.11	88 J - CZL
10 "			5383.29	CZL - RMB
2/2			5384.58	RMB - CAE
2-12			5386.16	CAE - RMB
2/7			5388.27	RMB - MEM
2/9			5389.70	MEM - RMB
2/16			5390.14	RMB - LOCAL
2/26		0.49	5390.63	RMB - LOCAL
3/8		0.75	5391.38	RMB - LGC
3/8		0.61	5391.99	LGC - RMB
3/17		0.54	5392.53	RMB - LOCAL
3/19			5393.06	RMB - PDIC
3/19			5394.49	PDIC - SSI
3/22			5395.49	SSI - DBN
3/22			5396.30	DBN - SSI

(D HUBBS I'STATE FLG)

(MCHUNK. IAVE KEZUVAO)

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
1-29			5398.3	SSI - PDK - RMG
2-23			5398.36	OIL & FILTERS CHG
2-23	5398.36		5398.36	VEHICLED W/ ENG # 4 CYL EXH STACK & INSTL FISH MOUTH DOUBLERS @ FLANGE. (W/ J. B. BROWN) 191373949 (W/D) HAVE APP. B.M. PHOUL 1 JEWELERS - BI
3-23	5401.05		5401.05	RMG - LLQ 2.2 IME (B.M. PHOUL 1 JEWELERS - BI)
3-23	5402.97		5402.97	LLQ - RMG 1.5 IME
3-27	5405.38			RMG - TBX
3-27	5407.64			TBX - RMG INT LW
4-1	5409.53			RMG - SSI
4-5	5411.53	2.0		SSI - RMG
4-8	5413.70	2.17		RMG - GLH 2.0 IMC
4-8	5416.31	2.61		GLH - FTW 2.4 IME
4-11	5419.91	3.61		FTW - RMG
4-17	5421.68	1.77		RMG - SSI
4-19	5423.75	2.07		SSI - RMG
4-21	5425.68			RMG - SSI ✓
4-22	5427.50			SSI - RMG ✓
4-23	5429.66	2.16		RMG - MOB P SNYDER - MASCAM'S C/TS - OIL CHG 2.0 IME

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
1999				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)
APR 23	5431.48	1.82		MOB - RMG (1.75 IMC) [unclear] [unclear]
4/28	5433.83	2.35		RMG - RDU N Sweeney [unclear] [unclear]
4/28	5436.23	2.40		RDU - RMG " 2.15 IMC "
APR 30	1999			REMOVE LH ENGINE # 4 EXH STACK AND REPLACE WITH REBUILT STACK PN 23850-14 (SEE YELLOW TAG) FROM Aircraft Exhaust Systems, Spencer & Everett AP 260293059
TACH	5436.23			
5/15	5438.58		5438.58	RMG - RDU N Sweeney M'CRAY
5/18	5439.68		5439.68	RDU - ROA B. McPhaul BRUNSTON IN
5/18	5440.56		5440.56	ROA - RDU " " 50
5/18	5443.08	2.52	5443.08	RDU - RMG " " 245
5/21	5443.91		5443.91	RMG - CEU (P)
5/22	5444.81		5444.81	CEU - RMG (P) .5 IMC
5/	5445.70		5445.7	RMG - DBN
5/	5446.65		5446.65	DBN - RMG

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
19 99				
MAY 26 1999				REMOVE DROP RH FUEL BOOST PUMP, MODIFY BOOST PUMP MOUNTING BY INSTALLING 2EA PIPER BRACKET PN# 33963-002 AND INSTL NEW LATE STYLE PUMP PN# C8100-5 SN# 84368 FROM AIRCRAFT ACCESSORIES, (SEE YELLOW TAG) PURGE FUEL SYSTEM LEAK CHECK + RUN AIRCRAFT (OIL).
	TACH 5448.69			Spencer L Ewert AP260293059
MAY 30	5450.72		5450.72	RMG - SSI
	5452.77		5452.77	SSI - RMG
JUNE 7	5455.98	3.21	5455.98	RMG - CGX (NEEDED)
JUNE 8	5456.50		5456.50	CGX - RMG Dup
	5459.90		5459.90	Dup - RMG
	5460.99		5460.99	RMG - AGS
	5462.24		5462.24	AGS - RMG
	5464.17		5464.17	RMG - SSI

NAME 19 <u>99</u>	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)
	5465.3		5465.3	SSI - DALL
	5466.7		5466.70	DNA - RMG
	5468.75		5468.75	RMG - SSI
7/12	5471.03			SSI - CUA (GDUFF - BI) 1 ILS APPR
7/12	5471.54			CUA - RMG " " 1 NDB APPR
7/14	5473.65			RMG - ROA (B. McAVANL - BI) 1 ILS APPR
7/14	5474.72			ROA - ROU " 1 ILS APPR
7/15	5476.98			ROU - RMG "
7/17	5478.94			RMG - SSI (P)
7/19	5480.92			SSI - RMG
	5484.17			RMG - ROU N SWOZEY - M'GARY
	5486.18			ROU - SSI "
	5488.21			SSI - ROU "
8/7	5490.80			ROU - DNN S BRIC HIBERNIA
8/7	5491.11			DANN - RMG S. BRIC - HIBERNIA
8/9	5492.80			RMG - SSI
8/9	5495.30			SSI - RMG
8/13	5496.04			RMG - LOC D HOBBS DANCE

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Adjustments Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
8/13	5497.6			LGC - SSI D HUBBS DFACE
8/16	5499.48			SSI - RMG
8/19	5501.46			RMG - MOB MASHAM - SNEYD 1.2
8/19	5503.48			MOB - RMG " " 1.2
8/24	5505.19			RMG - JZI " "
8/23	5506.11			JZI - SSI " "
8/23	5507.91			SSI - VPC SOUTHERN YARD
8/23	5508.16			VPC - RMG " "
8/27	5510.04			RMG - MOB MASHAM - LAPERE
8/27	5512.38			MOB - SSI " "
8/30	5513.98			SSI - LGC HUBBS - DFACE
8/30	5514.62			LGC - RMG " "
9/10	5515.30			RMG - CON " "
9/10	5515.96			CON - RMG " "
9/11	5516.64			RMG - CON " "
9/11	5517.28			CON - RMG " "
9/13	5519.38			RMG - MYR MEALERS - WOOD

FAA FORM 8610-1
 AIRWORTHINESS INSPECTION
 U.S. Department of Transportation
 Federal Aviation Administration

COPIES
 JUL 1999

RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations <small>Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)</small>
9/13 5520.85			MYR - DBN MANUAL - G, CHARGES
9/13 5522.12			DBN - RMB CURRS WOOD
9/15 5524.35			RMB - ROA LEES CHARGES 1.02
9/15 5526.34			ROA - VPC " "
9/15 5526.61			VPC - RMB SYD "
9/17 5528.87			RMB - RDU LEES CHARGES 2.0
9/18 5531.13			RDU - SSI " " 1.6 INC
9/19 5533.24			SSI - RDU " " 1.7 INC
9/20 5535.63			RDU - RMB " " 1.5 INC
SEPT 21 1999			REMOVE INOP LH FUEL PUMP, MODIFY BOOST PUMP MOUNTING BY INSTL OF 2EA 33963-002 BRACKET AND INSTL NEW LATE STYLE CB100-F PUMP FROM AIRCRAFT ACCESSORIES (SEE YELLOW TAG) PURGE FUEL SYSTEM, LEAK CK + TEST RUL AL (OK)
TACH 5535.70			Spencer L Emitt AP260293059

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
9/21	5537.15			RMG - AKH PHARR YARNS
9/23	5538.61			AKH - RMG " "
9/27	5540.57			RMG - SSI
9/26	5542.65			SSI - RMG 1.8 DMC
10/1	5547.76			RMG - RDU 1.9 DMC
10/3	5547.25			RDU - RMG 2.1 DMC
OCT 4 1999	TACH 5547.3			INSTL NEW ROSE TIRE, BALANCE + PACK BEARING. Spencer & Co. AP 260293059
10/8	5549.47			RMG - SSI
10/11	5551.50			SSI - RMG
10/14	5552.36			RMG - LGC 1.25 APP .6 DMC D HOBBS JURFACE
10/14	5553.04			LGC - RMG
10/28	5554.55			RMG - VJI BURLINGTON B. McHAUL
10/29	5555.45			VJI - ROA " "
10/30	5556.27			ROA - VJI " "

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)
19 99				
10-30	5557.76			VJI-RMG BURKINGTON: B. McPHAIL
10-31	5559.97			RMG-SSI " "
11-1	5561.83			SSI RMG " "
11-16	5562.40			RMG-LGC INTERFACE - D. HUBBS
11-16	5563.12			LGC-RMG " "
11-20	5563.39			RMG-VPC (SYNDY)
11-20	5565.23			VPC-SSI "
11-22	5567.35			SSI-DMA " "
11-22	5567.63			DWN-RMG " "
11-26	5569.85			RMG-SSI
11-27	5571.69			SSI-D73
11-27	5572.85			D73-SSI
11-29	5575.0			SSI-RMG
12/3	5575.6			RMG-LGC INTERFACE REPAIRS CII
12/3	5576.3			LGC-RMG " "
12/15	5577.0			RMG-LGC " "
12/15	5577.70			LGC-RMG " "

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
19 99				
12/17	5579.96			RMB - ROA BURLINGTON IND J. WALKER
12/17	5582.14			ROA - RMB " " " "
1/6/00	5584.16			RMB ROA " " " " R. HUTCHISON
1/6/00	5586.2			ROA RMB " " " " " "
2/9/00	5586.2			ANNUAL 9 FEB 2000
				INSTALL NEW G-35 BATTERY, FRESH ELT BAT. (INSP PER FAR 91.207(d), (1-4)) REPLACE DATE 1-2002, ENG INDUCTION AIR FILTERS (BRACKET), VACUUM SYS FILTER, VAC REGULATOR FILTER, INSTL NEW FUEL CELL LA AUX PN 454-332, SR NO CR574, AND RA MAIN CELL PN 454-335, SN CR618 & RH ENG ENG OUT - BD MAN. DRAIN VALVE. C/W AD 99-14-01 (S/S 98-04-27) ICING WARNINE INSERT IN FIA MAN. C/W AD 94-13-10 100 HR INSP OF STABILIZER FITTINGS IN AFT FUSelage. NEXT MILE SIDE BRAKE STD INSP PER 97-01-01(R) DUE @ 5901.52, C/W AD 96-20-07 DUE ON CABIN HEATER @ HTR HR MTR 808.3 ON FEB 2002. C/W AD 83-10-01, 50 HR
				CONT NEXT PAGE

CONT 9 FEB 2000

DATE 19 _____	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations <small>Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)</small>
INSP & CLEANING OF FUEL STRAINER, C/W AD79-12-07 PAR A 50 HR INSP OF FUEL SELECTOR VALVES, INSTL NEW LDG GEAR SHOCK CORD. PER AD77-13-21, PAR B, NEXT INSP DUE @ 6086.2 OR FEB 2003. NEXT PAR A INSP DUE @ 5901.52, AD'S CHECKED PART 00-02, INSTL NEW RM LDG LIGHT, REPAINT WING W/LR 5586.2 5586.2				CERTIFY THAT THIS AIRCRAFT HAS BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND WAS DETERMINED TO BE IN AIR WORTHY CONDITION
HEATER W/L W/LR 708.3 TSO 708.3				<u>Alton F. Everett</u> AP1373849 AUTHORIZED INSPECTOR
[Empty rows for future entries]				[Empty rows for future entries]

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
2/11	5588.22			RMG SSI
2/14	5590.32			SSI - RMG
3/3	5592.18			RMG - SSI
3/6	5594.20			SSI - RMG
3/10	5596.12			RMG ROA BURLINGTON IND. - J WATKINS
3/11	5598.37			ROA - RMG " "
3/13	5600.26			RMG SSI
3/13	5602.77			SSI - CUA RADIO REPAIR
3/13	5603.09			CUA RMG " "
3/14	5604.50			RMG - SST
3/14	5605.95			SST - RMG
3/17	5606.36			RMG - CUA
3/17	5606.79			CUA - RMG
3/18	5608.88			RMG SSI
3/20	5610.83			SSI - RMG
3/22	5611.46			RMG - LGC IMPROVE FLOORING - HOBBS
3/22	5612.66			LGC - RMG " "

DATE 2000 15	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)
4/6	5613.81			RMG - SSI
4/8	5615.9			SSI RMG
4/10	5617.84			RMG - SSI
4/12	5619.2			SSI - LGC INTERFACE ^{HOBBS} FLOORING
4/12	5619.86			LGC RMG " "
4/19	5620.47			RMG - LGC INTERFACE FLOORING-DAY
4/19	5621.18			LGC - RMG INTERFACE " "
4/22	5623.20			RMG - SSI
4/24	5627.44			SSI - RMG
4/30	5627.37			RMG - SSI AQUATIC
5/1	5629.00			SSI - FTY PLANT PESSI AQUATIC
5/1	5629.39			FTY - RMG " "
5/3	5630.11			RMG - LGC INTERFACE FLOORING-KEMBA
5/3	5630.90			LGC - RMG " "
5/5	5633.07			RMG - ROU MASTERPLAN TAB - SWEEP
5/5	5635.40			ROU - RMG " "
5/8	5637.90			RMG - ROU BURLINGTON IND - WORK

DATE 19 <u>2000</u>	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
5/8	5640.85			ROA - RMG Burlington Industries
5/13	5642.56			RMG - SSI
5/15	5643.47			SSI - DBN Mohawk Ind Leonard
5/15	5644.63			DBN RMG " " Horton
5/20	5646.57			RMG SSI
5/22	5648.78			SSI - RMG
5/27	5650.89			RMG RDV INSTRUMENT - N. SWEEZY
5/27	5653.27			RDV - SSI " "
5/28	5655.39			SSI - RMG
6/3	5657.05			RMG - SAV
6/4	5658.85			SAV - RMG
6/4	5660.72			RMG - SSI
6/6	5662.96			SSI - RMG
6/17	5664.88			RMG - SSI
6/19	5666.89			SSI - RMG
7/1	5668.71			RMG SSI
7/5	5670.73			SSI RMG

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
3/2000				
9/24	5701.72			SSI - RMB
9/29	5704.11			RMB - RDU
10/2	5706.45			RDU - RMB
10/13	5708.33			RMB - SSI
10/15	5710.39			SSI - RMB
10/17	5712.47			RMB - MUB
10/17	5714.32			MUB RMB
10/22	5714.71			VOR1 351° VOR2 347° RMB 348° <i>Alman</i>
10/22	5714.71			RMB - C4A TO STAR ANTONIOS FOR #1 COMM. REPAIR
10/22	5715.15			C4A - RMB " "
10/26	5716.87			RMB - VJI R. HUTCHISON BURLINGTON DUG
10/26	5718.21			VJI - RMB INT LOG " "
11/1	5718.83			RMB - LGC HOBBS, CAMP INTERFACE FLOORING
11/1	5719.49			LGC - RMB " " " "
11/1	5721.39			RMB - SSI
11/6	5723.41			SSI - RMB

DATE 2000 19	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
11/27	5723.94			RMB - LOCAL
12/5	5724.67			RMB - LOC INTERFACE PLANNING
12/5	5725.36			LOC - RMB (D. Acker, J. Hall, J. Rowan)
12/11	5725.77	0.12	5725.77	RMB - LOCAL
2001				
1/06	5726.49	0.72	5726.49	RMB - LOCAL
1/25	5727.63		5727.63	RMB - DNL WOOD PAWS TO DEVICES
1/28	5728.92		5728.92	DNL - RMB " "
1/30	5729.96		5729.96	RMB - DNL " "
1/30	5731.19		5731.19	DNL - RMB " "
1/31	5732.60			RMB - BHM TO TRADE SHOW "SURFACES"
2/2	5732.75			BHM - RMB " "
2/11	5734.30	1.55		RMB - SMS
2/11	5735.97	1.47		SMS - RMB 1.22 INC R
2/15	5737.35			RMB - TRI ILS LOG 1.1 INC
2/15	5738.36	1.01		TRI - RMB .98 INC B
2/16	5740.13			RMB - TRI 1.2 INC 1 ILS

DATE 2001 19	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
MARCH 16, 2001	5743.9		5743.9	TACH. Complete AN ANNUAL inspection
	5743.9	Left	TACH	using PA30 m/m inspection form
	4604.1	Right	TACH	dated 10/1/98 AS A Guideline. y/w
				AD 94-13-10 by installing Pipers Kit
				760-835 on upper Left and Right
				STABILIZER fittings. Lower fittings were
				Previously modified. y/w AD 83-1001
				50 hr inspection at Fuel Station. y/w AD
				79-12-08 per SB 851 Fuel selector
				inward port leakage, none detected.
				ELT ckd per 91.207d CKs Satisfactory
				All cable Tensions ckd per PA30 m/m and
				are satisfactory. Clean Heater Ignitor
				Heater Am 729.2. Installation P/N
				487-862 nose gear Downlock switch.
				Adjusted per PA30 m/m. —————

CONT next page →

DATE 2001 19	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
MARCH 16, 2001			5743.9	CONT. FROM PREVIOUS PAGE. Landing gear retractor CK & Emergency extension CKS. SATISFACTORY. All lights electrical system OPS CK SATISFACTORY.
				Chattanooga Aero Service, Inc. Lovell Field Chattanooga, Tennessee 37421 FAA Repair Station DX4R144M I certify that this aircraft has been inspected in accordance with a <u>ANNUAL</u> inspection as re- quired by F.A.R. and was determined to be airworthy condition.
				Date <u>3-16-2001</u> Total time <u>5743.9</u>
				Details of this inspection, on file under W/O <u>A8026</u>
				Date <u>3-16-01</u> Signature <u>[Signature]</u>
				411045485 IA

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)
3-26				RMG - MOB 1.7 DMC
3-26	5748.16			MOB - RMG 1.2 DMC
3-30	5748.69			RMG - MOB CHA
3-30	5749.04			CHA RMG
4/2	5750.88			RMG - SSI
4/2	5753.01			SSI - RMG
4/6	5754.26			RMG - DNL
4/8	5755.53			DNL RMG
5/7	5756.22			RMG - LOCAL
5/14	5758.04			RMG SSI
5/14	5759.99			SSI - RMG
5/18	5761.94			RMG SSI 1.0 HRS IMC
5/20	5763.86			SSI - RMG 1.6 HRS IMC
5/25	5765.73			RMG - SSI 1.5 " IMC
5/29	5768.17			SSI - RMG 2.5 " IMC
6/2	5769.29			RMG - DNL
6/3	5770.54			DNL - RMG

All work done by [unclear] at [unclear] 13750 [unclear]
 INST. & BALANCE NEW RA-TIRE.
 PACK WITH DEBRIS
 21 JUN 1953

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
2001 6/9	5772.40			RMG - SSI
6/11	5773.71			SSI - MEN
6/11	5774.77			MEN - RMG OIL CHANGE
7/1	5774.80			VOR CHECK RMG #1350 #2347 (348)
7/1	5775.29			RMG - LOCAL CK/O FUEL SUPP/FLOW
7/2	5778.25			SSI - ABS
7/2				ABS - SSI
7/2	5779.33			RMG - SSI
7/9	5781.44			SSI RMG
7/13	5782.67			RMG - RVN EXAMINE YARN WINGOR
7/13	5783.64			RVN - DNN TO PICK UP HIB. SAMPLES
7/13	5783.91			DNN - RMG " "
7/14	5785.80			RMG - SSI
7/16	5787.58			SSI - RMG
7/20	5788.89			RMG - ABS 1.0 IMC
7/20	5790.04			ABS - RMG 1.0 IMC
8/18	5790.47			RMG LOCAL

DATE 2001 19	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)
8/24	5791.12			RMG - LGC D. HOBBS - INTERFACE INC.
8/26	5793.65			LGC - RDU N. SWEET MASTER CRAFT INC.
8/28	5796.09			RDU - RMG " " "
9/08	5798.20			RMG - SSI
9/10	5800.04			SSI - RMG OIL & FILTER CHG
9/21	5800.65			RMG - LGC D. HOBBS, INTERFACE INC.
9/21	5802.09			LGC - SSI " "
9/24	5804.60			SSI - RMG J, G DMC 1 ILS
9/29	5806.43			RMG SSI
10/2	5808.41			SSI MYR M. EWENS - EWENS WORK
				10 OCT 2001 REMOVED MAN. PRES
				SN # 173422 + INSTL OHV UNIT, SN
				179678, BY PRECISION AVIONICS,
				WO R2445 DATED 10-08-01.
				TACH 5813.17 Alter F. [unclear]
				AF 1373849 (A.I.)

DATE 2001	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
10-2	5810.46			MTR-DBN MURPHY TO FORSMAN - PAUL BROWN
10/2	5813.17			DBN - RMG MURPHY - CURRIS WOOL HOLDINGS LTD
10/17	5815.26			RMG - SSI
10/22	5817.36			SSI - RMG
10/30	5817.97			RMG - LOCAL
11/1	5820.00			RMG - SSI
11/4	5822.02			SSI - RMG 1.0 IMC
11/9	5822.65			RMG - LGC INTERFACE/AQUASIL
11/9	5823.25			LGC - RMG "HUBBS, PONTARIN"
11/12	5824.43			LOCAL
11/21	5826.66			RMG - RDU
11/24	5829.33			RDU - RMG RMG VOR 1 + 2
12/16	5829.75			RMG LOCAL VOR 2 - 1
1/15	5830.44			RMG - LOCAL
2/10	5831.03			RMG - LOCAL
2/15	5832.98			RMG - SSI
2/18	5834.90			SSI - RMG

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations <small>Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)</small>
2002				
5/21	5835.52			RMG - LGC
2/21	5836.15			LGC - RMG
2/27	5836.78			LOAN RMG
4/19	5837.47			RMG - LGC
4/19	5838.07			LGC - RMG
4/24	5840.42			RMG - LLQ
4/24	5842.41			LLQ - RMG
4/27	5844.43			RMG - SSI
4/29	5846.85			SSI - LHA
May 21, 2002			5846.9	LH TACH 5846.9 RH TACH 4706.6 Annual inspection completed using PMA M/M TABLE III - AS A GUIDELINE. C/w AD 83-10-01 insp of Fuel System OK C/w AD 79-12-08 No Leakage detected C/w AD 96-20-07 Heater dewy test Satisfactory C/w AD 2000-08-01 per 50 A107 Heater with OK, Satisfactory

DATE 19__	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
5-21-02			5846.9	<p>Cont. from Previous Page. Replaced INST FILTER with new D918T. Replaced both VAC. Reg filter. B351. Installed new induction filter of a Eng. both Brake Actuated with new lining. ELT Battery Replaced with new unit 54p MAY 2004. Old p 9/1.207d</p> <p>SATISFACTORY.</p> <p>Chattanooga Aero Service, Inc. Lovell Field Chattanooga, Tennessee 37421 FAA Repair Station DX4R144M</p> <p>I certify that this aircraft has been inspected in accordance with a <u>ANNUAL</u> inspection as required by F.A.R. and was determined to be airworthy condition.</p> <p>Date <u>MAY 21, 2002</u> Total time <u>5846.9</u></p> <p>Details of this inspection, on file under W/O <u>A8305</u></p> <p>Date <u>5-21-02</u> Signature <u>[Signature]</u> <u>4110459852A</u></p>

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations - Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries)
2002				
5-22-02	5847.47	0.57		CUA - RMB RET FM ANNUAL INSP
5-25-02	5849.50	1.97		RMB - IGX NSURVEY - MASTER CRMS
5-26-02	5851.80	2.30		IGX - RMB " "
6-16-02	5853.28	1.30		RMB - ABN MUCK CATING
6-16-02	5854.89	1.79		ABN - RMB " " "
6-17-02	5856.15	1.26		RMB - DNL
6-17-02	5857.24	1.09		DNL - RMB
7-11-02	5869.10	1.80		RMB - SSI
7-11-02	5861.45			SSI - RMB
8-14-02	5862.12			RMB - LGC INSURANCE FROM 06
8-14-02	5862.77	0.66		LGC - RMB " " - DUBOIS
8-24	5864.58			RMB - SSI
8-26	5866.58			SSI - RMB
9-11	5867.17			RMB - LGC INSURANCE FLOORING, KIMBLE
9-11	5867.80			LGC - RMB " " C. QUIMER
9-29	5868.43			RMB - LOCAL
2-13	5869.25			INST COMP CIR + FLIGHT RETIRE

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations
19 2003				Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
2/13/03	N8666Y	1.1 HRS	RMB-LCL	1251, rmb, 2 NPBT, VOROME 19, Holding patterns, standard rate turns, mag check Go Around, FAR Review, Radio Procedures, ME Review

Endorsement for completion of Flight Review FAR# 61.56

Mr. Armin Maier, holder of pilot certificate #258-54-6076, has satisfactorily completed the Flight Review required under FAR 61.56 on February 13, 2003.

2/10/03 Howard J. Lowden *Howard Lowden*, 315467326 CFIIASMEI expires 07/31/2003

Endorsement for Completion of Instrument Proficiency Check FAR# 61.57 (c) (2)(d)

Mr. Armin Maier, holder of pilot certificate #258-54-6076 has satisfactorily completed an Instrument Proficiency Check required under FAR 61.57 (c)(2) on February 13, 2003.

2/10/03 Howard J. Lowden *Howard Lowden*, 315467326 CFIIASMEI expires 7/31/2003

3/08	5870.68	0.73	5870.68	LOCAL	
3/20				RMB-MCN	IMC
3/20	5873.43		5873.43	MCN-SST	IMC
3/22	5875.35			SST-RMB	
4/12	5876.60		5876.60	RMB-DNL	
4/14	5877.87		5877.87	DNL-SOP	C. KENNEDY/GULISTAN 1.6 IMC
4/14	5879.84		5879.84	SOP-RMB	" " 2.2 IMC
4/18	5882.08		5882.08	RMB-ROW	1.75 IMC

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------	---------------------	---------------	-----------------------	---

June 20, 2003
 ACTT: 5889.32
 Left Tach: 5889.32
 Right Tach: 4749.02

Piper PA-30 N8666Y
 Serial Number 30-1797

1. Annual inspection using Table III-I in the PA30 Maintenance Manual as a guide.
2. Comply with AD 79-12-08, part A, IAW SB851. No leakage noted.
3. Comply with AD83-10-10, para (A), cleaning/inspcetion of fuel strainers.
4. Comply with AD77-13-21as follows: para (a) complied with by inspection, and the following parts were replaced; 2ea 14843-018 bushings in nose gear drag brace, and 2ea 14843-030 bushings in main gear sidebrace studs. Paragraph (b) complied with by installing new 451-349 bungee cords on left/right gear.
5. Comply with AD97-01-01R1 by installing new 487-634 sidebrace studs on left/right main gear. *Due at 6889.32*
6. New J9613-19 Lord mounts installed on left and right engines.
7. New BA-10 induction air filters installed
8. New B3-5-1 vacuum relief filters installed.

— CONT —

Chattanooga Aero Service. Inc Phone 423-892-2121
FAA Repair Station DX4R144M

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------	---------------------	---------------	-----------------------	--

2003
 June 20, 2003
 TACH: 5889.32
 L Tach 5885.32
 R Tach 4746.02

9. Installed new 18457-000 tiedown ring on right wing.
10. Installed new 452-808 bearing on left aileron inboard hinge.
11. Performed gear retraction normal and emergency modes.

Chattanooga Aero Service, Inc.
Lovell Field
Chattanooga, Tennessee 37421
FAA Repair Station 588934M

I certify that this aircraft has been inspected in accordance with a FORWARD inspection as required by F.A.R. and was determined to be airworthy condition.

Date 6/20/03 Total time 5889.32

Details of this inspection, on file under W/O A8631

Date 6/20/03 Signature Tommy E. [Signature]
 AEP411786614 FA

5/23		58	CHA - TYS	ILS - RS
6/23			TYS - RMG	ILS VAR ADF R1
6/23			RMG - CHA	ILS R-20
6/23		5892.49	CHA - RMG	-
7/13		5893.10	RMG - LOCAL	-

DATE 2003 49	TOTAL TIME IN SERVICE	Reference of Major Repairs and Major Alterations To FAA Form ACA-337 by Date, or to the Work Order by Number and the Approving Agency
7/17	5896.00	RMG - RDU
8/7	5899.17	RDU - CHA
	5900.17	CHA - RMG
10/16	5901.62	RMG - VJI
10/16	5903.31	VJI - RMG
10/17	5904.94	RMG VJI
10/17	5906.70	VJI - RMG
11/15	5906.85	RMG - LOCAL
11/21	5906.85	REMOVED STANDBY HORIZON SNT 60296K & INST OHV UNIT SNT 82371N. <i>Alton A. Enright AP 1373849 (A)</i>
12/7	5907.14	RMG LOCAL
2/7	5907.44	RMG LOCAL
3/7	5907.69	RMG LOCAL
3/13	5908.19	RMG LOCAL
3/14	5910.32	RMG/SSI
3/14	5912.46	SSI/RMG

OHV BY PRECISION AVIONICS & INSTRUMENTS
WO FT 4071SW, 11/18/03

DATE

19

TOTAL
TIME IN
SERVICE

Reference of Major Repairs and Major Alterations To

FAA Form ACA-337 by Date, or to the Work Order by Number and the Approving Agency

JUNE 17, 2004 ANNUAL INSPECTION COMPLETED. INSTALLED NEW LAMP IN LEFT LANDING LIGHT, NEW TIRE AND TUBE ON NOSE GEAR WHEEL, AND NEW INDUCTION AIR FILTER ELEMENTS. C/W AD 79-12-08 INSP OF FUEL SELECTOR VALVES, C/W AD 83-10-01 INSP & CLEANING OF FUEL STRAINERS, C/W AD 96-20-07 BY PDT OF COMBUSTION TUBE AND INSTALLED NEW 94E42-3 COMBUSTION AIR PRESSURE SWITCH (HEATER HOBBS 752.2) C/W ANNUAL INSPECTION REQUIREMENTS OF ELT PER FAR 91.207(d) AND INSTALLED NEW BATTERY PACK. BATTERY EXPIRES MAY 2006.

AIRCRAFT TT 5947.97

LEFT TACH 5947.97

RIGHT TACH 4807.12

CERTIFY THAT THIS AIRCRAFT HAS BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND WAS DETERMINED TO BE IN AN AIRWORTHY CONDITION.

James A. Owen
A&P 2050165 IA

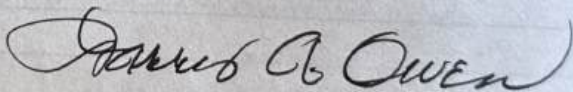
DATE

TOTAL
TIME IN
SERVICE**Reference of Major Repairs and Major Alterations To**

FAA Form ACA-337 by Date, or to the Work Order by Number and the Approving Agency

L&M AIRCRAFT INC.
ROME, GA 30165N8666Y Piper PA30-160 s/n 30-1797
August 13, 2004 Tach L 5986.62 Hours

Installed new GE4509 lamps in both landing light positions.
Left Fuel Flow Indicator, p/n 6062G49 s/n 53418, overhauled
by Precision Avionics & Instruments on work order # U4505
dated 8-5-04. Leak check good.

Larry A. Owen
A&P 2050165

DATE

19

A.D.
NUMBERTOTAL
TIME IN
SERVICE**Airworthiness Directives**

Chronological Listing of Compliance and Method of Compliance

L&M AIRCRAFT INC.
ROME, GA 30165N8666Y Piper PA30-160 s/n 30-1797
February 04, 2005 Tach L 6035.59 R 4894.77 HoursInstalled compass P/N CS23550L4-M23-R
Performed compass Swing. Operational check good.L&M AIRCRAFT INC.
ROME, GA 30165Aaron Trotter
A&P 2736354N8666Y Piper PA30-160 s/n 30-1797
March 22, 2004 Tach L 5920.19 R4779.50 HoursInstalled new condor 6.00-6 tire and tube tire SN
3228W00136. On left main wheelMitchell Todd Boone
A&P 255653270

DATE
19 _____

A.D.
NUMBER

TOTAL
TIME IN
SERVICE

L&M AIRCRAFT INC.
ROME, GA 30165

N8666Y Piper PA30-160 s/n 30-1797
March 07, 2005 Tach L 6066.43 R4925.45 Hours

Installed 2 new Cleveland brake disks P/N 164-02201.
Installed all new brake linings P/N 066-06200 & 066-06500 and all new mounting pins P/N 177-00300.
Taxi test and operational check good.

Mitchell Todd Bone

Mitchell Todd Bone
A&P 255653270

5.27.05 Tech L 6091.86
R 4950.74

Complied with Piper SB 836A as per SB
Instructions. Replaced Taxi Light with new
6E 4509. Ops check good.

A&P 273635c1

[Signature]

-END-

N8666Y

Airframe

Date: 3/24/04

Right Tach: 4781.44

Removed the right main wheel. Removed the damaged tire and tube. Disassembled, cleaned and visually inspected the wheel assembly with no defects noted. Installed a new 600 X 6-6AH tire, serial number BE343703 and a new 600X6 tube, assembled the wheel assembly. Serviced the assembly with dry nitrogen. No leaks noted. Installed the tire and wheel assembly in accordance with the Piper PA30 maintenance manual, section 7-61 and saftied with a new MS24665-379, cotter pin. Torqued the brake back plate bolts in accordance with the Cleveland Wheels and Brakes Technicians Service Manual and saftied as required.

Authorized Signature

James A. Bobbitt
The Hangar Inc. A&P484860809

2930 Winchester Road, Suite 500 Memphis, TN 38118

WORK ORDER NO. 4461
MODEL 5934P-1/ALTIMETER SER
INSPECTOR
WORK

hangar
aircraft maintenance & repair

I certify that the altimeter, static system and altitude reporting test required by F.A.R. 91.411 and F.A.R. 43 Appendix E and F have been performed. The altimeter has been tested to 20000 ft.

Signature

Certificate #

UM4RS70M
MAC AVIONICS, INC.
3470 DRANEFIELD RD.
LAKELAND, FL 33811

Date: 6/29/05

(863) 646-8790

The transponder identified below was tested according to F.A.R. 91.413 and is approved for return to service:

MFR

Date

KNG
6/29/05
MAC AVIONICS, INC.
3470 DRANEFIELD RD.
LAKELAND, FL 33811

MODEL

Tech

S.N.

(863) 646-8790

C/RT#

KT76A
20807
PUM4R575M
N8666Y

