


ONE STOP AVIATION, INC.

REPAIR STATION XR3R981L
OCEANSIDE, CA 92058
Phone: (760) 721-1389

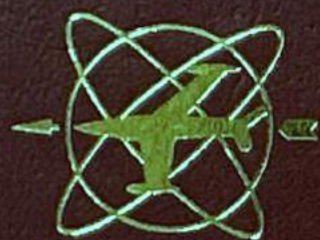

The Standard

ENGINE LOG

ASA-SE-2

Engine Record General Information

Manufacturer Lycoming

Model IO-320-B1A

Serial L-1161-55A

Type Certificate _____

This engine is currently installed in aircraft: _____

Minimum Octane Fuel _____

Oil Grade Summer _____

Winter _____

Magneto Time _____

Point Setting _____

Firing Order _____

Spark Plug Gap _____

Manufacturer's Recommended Overhaul at _____ hours

WARRANTY

All engines warranted against defect in material and workmanship to 240 hours or 12 months whichever occurs first, to include parts and labor. An additional pro-rated warranty to TBO will be based on a minimum of 40 hours per month usage. All parts and labor to be approved by One Stop Aviation prior to commencement of work. Cracked cylinders and crankcase excluded from all warranties unless it can be determined that they are a direct result of improper assembly. Loss of revenue or use of aircraft claims will not be allowed. Accessory items to be warranted by vendor of such items.

ONE STOP AVIATION, INC.
FAA Repair Station #XR3R981L
3245 Production Ave., Ste D
Oceanside, CA 92058-1340
(760) 721-1389

YEAR 20 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
--------------------	---------------------------	-------------------	-----------------------------	---

TACTIME: 2583.01 (L)

ENGINE CERTIFICATE

FAA Repair Station XR3R981L

6/25/17

Major overhaul engine in accordance with manufacturers specification and current federal aviation regulations. All current airworthiness directives complied with at overhaul. Magnaflux and Zyglo inspection of appropriate parts. Work Order No. 29862 on file at One Stop Aviation, Oceanside; engine reassembled, test run, and OK to return to service.

Model IO-320-B1A

Serial No. L-1161-55A

Authorized representative

Robert Smith

"O"SMOH

H.

YEAR
20____
DATERECORDING
TACH
TIMETODAY'S
FLIGHTTOTAL
TIME IN
SERVICE**Description of Inspections, Tests, Repairs and Alterations**

Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

TYPE: LYCOMING IO-320-B1A		WO: 29862	
Qty	Item	Qty	Item
1	SL-STD-1211 (EXPANSION PLUG, CRANK)	4	SL69603 (INTAKE HOSE)
4	SL13923A (BUSHING, CONNECTING ROD)	1	AA48110-2 (Oil Filter)
8	SL74637 (BUSHING, VALVE ROCKER)	8	72198 (PLUG-PISTON PIN)
4	ASC75089P010 (PISTON)	4	SL13790A (SHAFT, ROCKER VALVE)
4	SL19001A (EXHAUST VALVE)	8	SL12892 (THRUST BUTTON ROCKER SHAFT)
8	SL11800 (OUTER VALVE SPRING)	1	SL75072 (GEAR ASSEMBLY)
8	SL11795 (INNER VALVE SPRING)	1	SL61544 (PLUNGER)
8	SL60009 (KEEPERS INTAKE)	1	STD-2168 (IDLER GEAR NUT)
8	MS13997-3 (KEEPERS EXH)	8	SL72877. (LIFTER REGRND/EXCH)
4	SL3601-SC P10 (RING SET FOR STEEL CYL)	1	LW18840 (CAMSHAFT REGRND OUTRIGHT)
1	SL69371-1 (GASKET SET MAJOR OVERHAUL)	1	72082 (CRANKCASE OVH/EXCH BY DIVCO)
4	SL11020 (BEARING MAIN)	4	SLR75906 (ROCKER COVER GASKET SILICONE)
2	SL13884A (BEARING, FRONT MAIN)	4	MS13998-3 (EX ROTOR CAP)
1	SL1028-B (BALL, OIL PRESSURE)	1	2524335-10 (FUEL SERVO EXCH FOR OVH BY DIVCO)
1	SL61084 (SPRING, OIL PRESSURE)	1	2524232-2 (FLOW DIVIDER EXCH FOR OVH BY DIVCO)
1	SL-STD-2213 (CRANK BOLT)	1	AF15473 (FUEL PUMP-NEW)
8	SL61662A (BEARING, CONNECTING ROD)	4	SL74230A+ (GUIDE VALVE EXH)
8	SL78027 (BOLT, CONNECTING ROD)	4	SL61681A+ (GUIDE VALVE INT)
8	SL12186 (NUT-CONNECTING ROD BOLT)	4	SL72057A+ (SEAT INT)
4	SL-STD-2180 (HOSE OIL RETURN)	1	SL72058A+ (SEAT EXH)
3	SL31H-0.88 (IDLER BOLT)	8	SL31C-12 P03 (EXH STUD)
8	UREM-40E (SPARK PLUG)		



8130's
4/20/20
Hog's

