

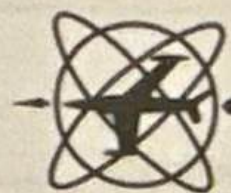


The Standard

AIRCRAFT LOG

ASA-SA-1

N8031Y LOG #4



The Standard

AIRCRAFT LOG

ASA-SA-1

Aircraft Record General Information

Manufacturer PIPER Model PA3013 TWIN COMANCHE
Serial PA30-1140 Registration Number N180314

Date of Manufacture _____

Engine(s) currently installed:

Manufacturer LYCOMING Model I0320-C1A (LEFT) Serial _____

Manufacturer LYCOMING Model I0320-C1A (RIGHT) Serial _____

Propeller(s) currently installed:

Manufacturer _____ Model _____

HUB Model _____ Serial _____ Serial _____

Blade Model _____ Serial _____ Serial _____ Serial _____

Blade Model _____ Serial _____ Serial _____ Serial _____

Registered Owner Record

Name SHELDON O. BRESIN

Address 6 BLACKSMITH CIR

City PHILLIPS RANCH State CA

From OCT 15, 1980 To _____

Name _____ Address _____

City _____ State _____ From _____ To _____

Name _____ Address _____

City _____ State _____ From _____ To _____

Name _____ Address _____

City _____ State _____ From _____ To _____

Name _____ Address _____

City _____ State _____ From _____ To _____

Name _____ Address _____

City _____ State _____ From _____ To _____

THIS LOG BOOK FOLLOWS LOG^H 3 ENTRY: 22 DEC 2012

Notes

YEAR: <u>2013</u>	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
----------------------	---------------------------	-------------------	-----------------------------	--

MODEL Piper Twin Comanche
 S/N 30-1140
 REG. NO. N8031Y



1805-D McKinley Ave. La Verne, CA 91750

FAA REPAIR STATION N2YR845Y

DATE 01/18/13
 W.O.# 6338
 HOBBS n/a
 TACH 2899.70

AIRFRAME LOGBOOK INSERT

THE AIRCRAFT AND/OR COMPONENT IDENTIFIED ABOVE WAS REPAIRED AND INSPECTED IN ACCORDANCE WITH CURRENT FEDERAL AIR REGULATIONS AND IS APPROVED FOR RETURN TO SERVICE ONLY FOR THE WORK ACCOMPLISHED. PERTINENT DETAILS OF THE REPAIR ARE ON FILE AT THIS AGENCY.

SIGNED R. Clark

R. Clark

for CRS N2YR845Y

DATE

01/18/13

1. Replaced (2) nutplates on belly access panel—R&R interior for access.
2. Replaced (3) clipnuts at tail cone and (1) nutplate.
3. Installed (4) belly drain cups.

2/4/13

Replaced aircraft battery with new
Concorde Battery RG-35AXC N.O. 13 Inc.

YEAR: <u>2013</u> DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------------------------------	---------------------------	-------------------	-----------------------------	---

MODEL Piper Twin Comanche
 S/N 30-1140
 REG. NO. N8031Y



1805-D McKinley Ave. La Verne, CA 91750
 909 596-1361
 FAA REPAIR STATION N2YR845Y

DATE 03/13/13
 W.O.# 6364
 HOBBS n/a
 TACH 2905.34

AIRFRAME LOGBOOK INSERT

THE AIRCRAFT AND/OR COMPONENT IDENTIFIED ABOVE WAS REPAIRED AND INSPECTED IN ACCORDANCE WITH CURRENT FEDERAL AIR REGULATIONS AND IS APPROVED FOR RETURN TO SERVICE ONLY FOR THE WORK ACCOMPLISHED. PERTINENT DETAILS OF THE REPAIR ARE ON FILE AT THIS AGENCY.

SIGNED R. Clark *R. Clark* for CRS N2YR845Y DATE 03/13/13

Repaired fiberglass on nose bowls and replaced (12) loose nutplates.

4/2/13				Replaced brake pads both mainwheels, A.D. Bressin
5/2/13	LT-2907.7	REINSTALLED GNS 486	AFTER REPAIR BY GABRIEL AT INC IN SOLEM OR W.O 120660 STAPLED TO BACK LOG BOOK COVER	A.D. Bressin

YEAR: <u>2013</u> DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
5-9 L	2908.2		4935.3	Jacked AIRCRAFT. checked TIRES & BRAKES
R	2903.1			checked GEAR RETRACTION. ELT. BATTERY
LSMOH	429.1			due 6/2014. Tested per FAR 91.207d &
RSMOH	1257.7			PASSED ALL TESTS. checked gear per AID -
				77-13-21a, Next due c 3908. b. due. 10/15 or 3393
	AD-77-13-21A c/w.			Annual Inspection Completed
	AD-97-01-01 Due 3408.			This Date <u>5-9-13</u> At <u>2908.2</u> Hours
	AD 79-12-08 c/w			I Certify That This Aircraft/Engine
	AD-83-10-01 c/w			Has Been Inspected IAW
	AD-79-20-10 c/w			An Annual Inspection And Was
	AD-74-16-08 c/w			Determined To Be In An
	AD-94-13-10 c/w			Airworthy Condition
				Mike Passwater AP1758050AI
				<i>Mike Passwater</i>

YEAR: 2013 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
5-11	2908.2			Replaced spin on oil filter and replaced air filters both engines.

MODEL Piper Twin Comanche
 S/N 30-1140
 REG. NO. N8031Y



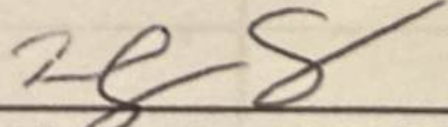
1805-D McKinley Ave. La Verne, CA 91750

FAA REPAIR STATION N2YR845Y

AIRFRAME LOGBOOK INSERT

DATE 05/20/13
 W.O.# 6394
 HOBBS 2908.25
 HH 923.40

THE AIRCRAFT AND/OR COMPONENT IDENTIFIED ABOVE WAS REPAIRED AND INSPECTED IN ACCORDANCE WITH CURRENT FEDERAL AIR REGULATIONS AND IS APPROVED FOR RETURN TO SERVICE ONLY FOR THE WORK ACCOMPLISHED. PERTINENT DETAILS OF THE REPAIR ARE ON FILE AT THIS AGENCY.

SIGNED M. Munoz  for CRS N2YR845Y DATE 05/20/13
 Performed AD2004-21-05; heater decay test IAW Janitrol Manual 24E25-1. Next due at HH hours 1023.4

YEAR: 2013 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
5-20	2908.25			I certify that the altimeter, static system, and pressure reporting system has been tested and inspected as per FAR 91.411 and FAR 91.413 and found to comply with FAR 43 Appendix E and F; altimeter and transponder tests and inspections. System Tested to: <u>22,000 Feet</u> Date: <u>5-20-2013</u> Signature: <u>[Signature]</u> Reg.: <u>N8031Y</u> Pacific Coast Radio CRS XXHR912K 1749 W. 13th St. Upland, CA 91786 (909) 985-1977

YEAR: 2013 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
10/07	2935.04			

MODEL Piper Twin Comanche
 S/N 30-1140
 REG. NO. N8031Y



DATE 10/07/13
 W.O.# 6478
 TACH 2935.04

1805-D McKinley Ave. La Verne, CA 91750

FAA REPAIR STATION N2YR845Y

AIRFRAME LOGBOOK INSERT

THE AIRCRAFT AND/OR COMPONENT IDENTIFIED ABOVE WAS REPAIRED AND INSPECTED IN ACCORDANCE WITH CURRENT FEDERAL AIR REGULATIONS AND IS APPROVED FOR RETURN TO SERVICE ONLY FOR THE WORK ACCOMPLISHED. PERTINENT DETAILS OF THE REPAIR ARE ON FILE AT THIS AGENCY.

SIGNED R. Clark  for CRS N2YR845Y DATE 10/07/13

1. Bled and serviced left brake system.

YEAR: <u>2013</u> DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
<u>22 Nov</u>	<u>L7-2936.93</u>			<u>REPLACING 6'D CELL BATTERIES IN ELT - FUNCTIONAL TESTS. Review ATB 765143</u>

MODEL Piper Twin Comanche
S/N 30-1140
REG. NO. N8031Y



DATE 01/30/14
W.O.# 6542
TACH 2938.90

1805-D McKinley Ave. La Verne, CA 91750

FAA REPAIR STATION N2YR845Y

AIRFRAME LOGBOOK INSERT


THE AIRCRAFT AND/OR COMPONENT IDENTIFIED ABOVE WAS REPAIRED AND INSPECTED IN ACCORDANCE WITH CURRENT FEDERAL AIR REGULATIONS AND IS APPROVED FOR RETURN TO SERVICE ONLY FOR THE WORK ACCOMPLISHED. PERTINENT DETAILS OF THE REPAIR ARE ON FILE AT THIS AGENCY.

SIGNED R. Clark

for CRS N2YR845Y

DATE 01/30/14

1. Drained fuel from left tip tank. Removed fuel tank and installed new landing light lens. Reinstalled tank and refueled tank.
2. Replaced battery with new.
3. R&R HSI for functional test performed by Aircraft Precision Instruments under their w.o. 1961.

YEAR: 2014 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
8-1				Jacked Aircraft, Replaced bungee cords.
L	2944.7			per A.D. 77-13-21-b. WX due 8/2017 or 3444.
R	2939.3			checked gear RETRACTION. ELT. due 8/2015.
SMOH	465.6			Tested & INSPECTED per FAR 91.207 & passed
RSMOH	1293.9			ALL TEST.
	A.D. 77-13-21 b	C/w		Annual Inspection Completed This Date <u>8-1-14</u> At <u>2944.7</u> Hours I Certify That This Aircraft/Engine Has Been Inspected IAW An Annual Inspection And Was Determined To Be In An Airworthy Condition Mike Passwater AP1758050AI 
	A.D. 79-12-08	C/w		
	A.D. 83-10-01	C/w		
	A.D. 74-16-08	C/w		
	A.D. 94-13-10	C/w.		

YEAR: <u>2014</u> DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------------------------------	---------------------------	-------------------	-----------------------------	---

MODEL Piper Twin Comanche
 S/N 30-1140
 REG. NO. N8031Y



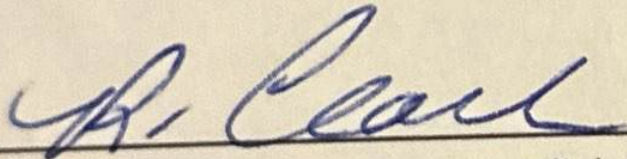
1805-D McKinley Ave. La Verne, CA 91750

FAA REPAIR STATION N2YR845Y

DATE 10/27/14
 W.O.# 6713
 TACH 2944.98

AIRFRAME LOGBOOK INSERT

THE AIRCRAFT AND/OR COMPONENT IDENTIFIED ABOVE WAS REPAIRED AND INSPECTED IN ACCORDANCE WITH CURRENT FEDERAL AIR REGULATIONS AND IS APPROVED FOR RETURN TO SERVICE ONLY FOR THE WORK ACCOMPLISHED. PERTINENT DETAILS OF THE REPAIR ARE ON FILE AT THIS AGENCY.

SIGNED R. Clark  for CRS N2YR845Y DATE 10/27/14

1. C/W AD2004-21-05; heater decay and pressure switch test.
2. Serviced L/H strut with N2.

Airworthy Condition
 Mike Passwater


YEAR: <u>2015</u>	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE
DATE			

Description of Inspections, Tests, Repairs and Alterations
 Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

MODEL	<u>Piper Twin Comanche</u>
S/N	<u>30-1140</u>
REG. NO.	<u>N8031Y</u>



1805-D McKinley Ave. La Verne, CA 91750

FAA REPAIR STATION N2YR845Y

AIRFRAME LOGBOOK INSERT

THE AIRCRAFT AND/OR COMPONENT IDENTIFIED ABOVE WAS REPAIRED AND INSPECTED IN ACCORDANCE WITH CURRENT FEDERAL AIR REGULATIONS AND IS APPROVED FOR RETURN TO SERVICE ONLY FOR THE WORK ACCOMPLISHED. PERTINENT DETAILS OF THE REPAIR ARE ON FILE AT THIS AGENCY.

DATE	<u>01/30/15</u>
W.O.#	<u>6771</u>
TACH	<u>2945.06</u>

SIGNED R. Clark  for CRS N2YR845Y DATE 01/30/15

1. Resealed R/H brake caliper. Reinstalled caliper and bled brake.
2. Replaced left and right brake discs. Bled L/H brake and serviced reservoir.

